

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner established by Henry Meldrum under GLO contract No.450 and dated June 11, 1882.

Surveyor General records state:

Set post 3 ft long 3 in square 24 in in ground for 1/4 Sec.Cor. marked 1/4 S on W face from which:

A tamarack 2.6 in diam bears N57°E, 5.0 lks dist marked 1/4S BT.
A fir 2.6 in diam bears N87°W, 68 lks dist marked 1/4S BT.

C-13

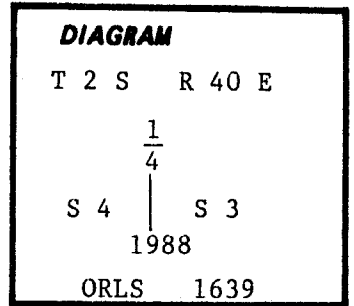

Description of corner evidence found:

Searched 6 man-hours on 6-30-88 and 7-06-88 for original corner and accessories on steep north mountainside - several rotten stumps and evidence of old wildfire, corner declared lost.

UNION COUNTY SURVEYOR	
Received	<u>9-22-88</u>
Filed	<u>9-23-88</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>132-88 R</u>

Description of monument and accessories established to perpetuate the original location of this corner:

At proportioned position between controlling Section Corners North and South...

Set 2 1/2" aluminum cap on 2" aluminum pipe 24" in ground & 6" projecting out of ground with surrounding rock mound & 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A white fir 16" diam brs N60°W, 19.6' dist mkd 1/4S4 BT.

A white fir 19" diam brs N39°E, 22.0' dist mkd 1/4S3 BT.

New BT's have a brass washer stamped PLS 1639 nailed to face of blaze.

Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly reestablished by me and witnessed by Patti Hanley on August 5, 1988.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of.....County Surveyor..... County of.....Union.....

State of.....OREGON....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)