
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner not previously established.

#### T3N R39EU-16

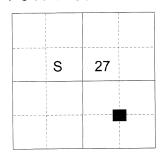

#### DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

SEE SURVEY NUMBER 066-2015

## DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

## TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 5/8" x 30" iron pin with 2 ½" aluminum cap, marked as shown below, 27 inches in the ground, in a collar of stone 1 ft. diam., from which:

#### NEW BEARING TREES:

A 5" White Fir bears South 67° East, a distance of 7.25 feet, marked SE 1/16 S27 BT. A 9" Douglas Fir bears South 42° West, a distance of 5.25 feet, marked SE 1/16 S27 BT.


Set a steel fencepost approximately 1 foot North of the corner monument. Corner falls approximately 3 feet West of fence corner.

I hereby certify that the corner was monumented November 12, 2015.

# **UNION COUNTY SURVEYOR**

REGISTERED **PROFESSIONAL** LAND SURVEYOR OREGON JEFFREY S. HSU 83571

Renewal Date: June 30, 2017

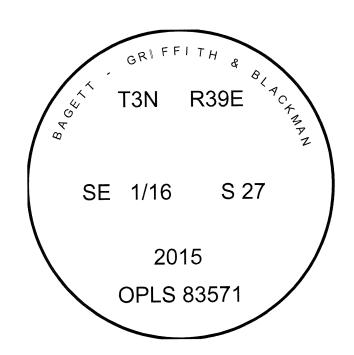

I used a steel tape and magnetic compass in the establishment of the bearing trees. Magnetic declination used was 15° East. Bearings are to a brass washer marked OPLS 83571 in the lower BT blaze. Distances are to at 60d spike in the right hand side of the tree.