


LAND CORNER RECORD

5680-2

1. T 4S R 37E No. N17 Cor. Sec. Mer. Will State Oregon N. F. Wallowa Whitman Dist. LaGrande

2. Corner Status

N-17

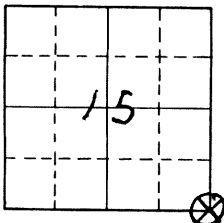

3. Original Description _____ Vol. _____ Page _____ Where Recorded _____

4. Description of Corners:

5. Investigation Notes:

Sec. 14 & 23 B.T. on ground & rotted.

Sec. 22 B.T. alive

Sec. 15 B.T. standing snag, visible scribing.

7. Photo Identification

Photo No. UBM-18B-46

Ident. By: D. Baker

9-11-63

8. Plane Coordinate Position Data

State _____ Zone _____

X _____

Y _____

Estab. By _____

Field Book No. _____

Where Filed _____

9. Evaluation

Authentic _____

Needs Verif. _____ Monument _____

Re-estab. _____ Survey _____

Land Status _____

6. Signed D. Baker Title Eng. Aid Date 9-11-63

UNION COUNTY SURVEYOR

Date Received _____

Date Filed 12-21-87

By G. LANGLITZ, DEPUTY

File No. 322-87R

N-17

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

N-17


History of original corner establishment:

Corner originally established by Herman Gradon under Contract No.452, dated June 16, 1882.

Surveyor General records state:

Set a post 4 ft long 4 ins square 24 ins in the ground for Cor to Secs 14,15,22 & 23 marked: T4SS14 on NE, R37ES23 on SE, S22 on SW and S15 on NW face with 3 notches on S and 2 notches on N edges from which:

- A fir 34 ins diam bears N80°E, 75 lks dist marked T4SR37ES14 BT.
- A fir 22 ins diam bears S40°E, 8 lks dist marked T4SR37ES23 BT.
- A fir 14 ins diam bears S50°W, 24 lks dist marked T4SR37ES22 BT.
- A fir 8 ins diam bears N20°W, 17 lks dist marked T4SR37ES15 BT.

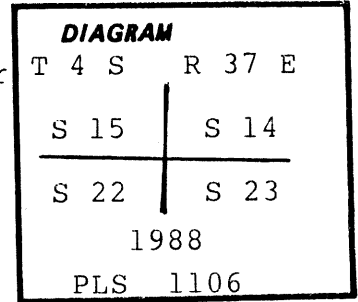

Description of corner evidence found:

No trace of original corner stone.

- A root hole brs N80°E, about 49.5'.
- A root hole brs S40°E, about 5.3'.
- A live 24" white fir brs S50°W, 15.8' to face of blaze & 16.3' to center of tree with healed blaze.
- A down rotten white fir about 8" dia brs N20°W, 11.2' to face of blaze & 11.5' to center of root hole with some visible scribes.

Description of monument and accessories | established to perpetuate the original location of this corner:

Corner point was re-established by measuring record distance from the blaze faces of NW & SW original BTs.

Set a 2½" aluminum cap on 2½ x 30" aluminum pipe 24" in ground, surrounded with mound of earth only and a 6' steel fence post South of corner with sign 54-9 attached. Cap marked as shown in corner diagram.

The area has been logged and there are few acceptable trees to mark as BTs. I marked 3 new bearing trees:

- A 16" white fir brs N32½°E, 82.4' scribed T4SR37ES14 BT.
- A 7" lodgepole pine brs S64½°E, 26.1' scribed T4SR37ES23 BT.
- A 9" white fir brs N42½°W, 87.6' scribed T4SR37ES15 BT.

New BTs have a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each BT.

Compass declination 19° East.

I hereby certify that the above corner monument was properly re-established to U.S.F.S. standards by me on October 25, 1988.

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

2-17

Office of.....County Surveyor..... County of.....Union.....
 State of.....Oregon....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR
Date Received <u>1-5-89</u> *GPO-591-971, 1988
Filed <u>1-6-89</u>
By <u>G. LANGRITZ, Deputy</u>
File No. <u>28-89 R</u>