


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

P-9

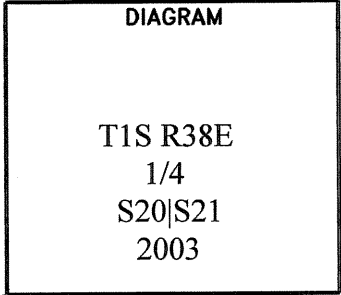

History of original corner establishment:

Corner originally established by David P. Thompson in 1863 under contract No. 103. Record states: Set post for 1/4 Sec. corner in mound of stone. In 2003 a dependant resurvey was made by BLM under special instructions dated April 29, 2003. **BLM notes state: Point of 1/4 sec. cor. of secs. 20 and 21, at proportionate dist., there is no remaining evidence of the original cor. Set a stainless steel post, 28 ins. long 2 1/2 ins. diam., 26 ins. in the ground, in a collar of stone, with brass cap mkd. From which a fir 6 ins. diam., bears S74 1/2°E., 24.2 ft. dist., mkd. 1/4 S21 BT. A tamarack 21 ins. diam., bears N7 3/4°W., 7.3 ft. dist., mkd. 1/4 S20 BT. Deposited a magnet in white plastic case at the base of the stainless steel post.

Description of corner evidence found:

Found 2 1/2" o.d. stainless steel pipe with 3 1/4" brass set flush with ground in a 3 1/2 ft. dia. mound of stone. Cap marked as shown in diagram. A 22" dia. tamarack with scribes visible on open single blaze bears N7 3/4°W - 7.3 ft. 54-9 and BLM BT signs attached. A 7" dia. White fir with scribes visible on open single blaze bears S74 1/2°E - 24.2 ft. 54-9 and BLM BT signs attached. There is a steel fence post with 54-9 and 54-2 signs 5 ft. south and a steel fence post with 54-2 sign 15 ft. north of corner.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Renews 6-30-06

Description of monument and accessories I established to perpetuate the original location of this corner:

I add two new bearing trees.

A 6" white fir scribed 1/4 S20 BT on double blaze bears N60 3/4°W - 9.2 ft. Nailed 3/4" dia. brass washer stamped "PLS 1106" to face of blaze. Attached signs 54-3 and 54-9 to tree. Painted blaze and a 6" red band around tree.

A 20" white fir scribed 1/4 S21 BT on double blaze bears S10°E - 23.1 ft. Nailed 3/4" dia. brass washer stamped "PLS 1106" to face of blaze. Attached signs 54-3 and 54-9 to tree. Painted blaze and a 6" red band around tree.

Painted blaze and 6" red band around existing bearing trees.

This corner was maintained on Nov 3, 2004. Used magnetic compass with 18° East declination and measured to accessories with a steel tape. Measurements to bearing trees are to the center of tree.

Witnesses: Jason M. Wells LSIT.

** The 2003 record by BLM is not yet recorded. We used preliminary copies of the field notes provided by the Wallowa Whitman National Forest.

Office of.....County of.....
State of, I hereby certify that the within instrument was filed
in this office for record on theday of, 20.....
.....by.....
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY
SURVEYOR

Date Received 12/9/04

Date Filed 12/10/04

By R. ROBINSON, DEPUTY

File No. 083-2004R

Dependent Resurvey of a Portion of the Subdivisional Lines,
T. 1 S., R. 38 E., Willamette Meridian, Oregon

FEET	<p>A fir, 22 ins. diam., bears S. 14¼° W., 118.0 ft. dist., mkd. T1S R38E S30 BT.</p> <p>A fir, 17 ins. diam., bears N. 61¼° W., 149.2 ft. dist., mkd. T1S R38E S19 BT.</p> <p>Deposit a magnet at the bottom of the drill hole.</p> <p>The ¼ sec. cor. of secs. 20 and 29 was searched for but not found.</p> <p>From the cor. of secs. 19, 20, 29, and 30, the point for the cor. of secs. 19, 24, 25, and 30, on the W. bdy. of the Tp., bears S. 88° 58' 40" W., 5132.16 ft. dist., hereinbefore described.</p> <hr/> <p>N. 0° 07' 52" W., bet. secs. 20 and 21.</p> <p>Over broken slope, through fir, tamarack, and pine timber with moderate undergrowth.</p> <p>2653.31 Point for the ¼ sec. cor. of secs. 20 and 21, at proportionate dist., there is no remaining evidence of the original cor.</p> <p>Set a stainless steel post, 28 ins. long, 2½ ins. diam., 26 ins. in the ground, in a collar of stone, with brass cap mkd.</p> <p style="text-align: center;">T 1 S R 38 E 1/4 S 20 S 21 2004</p> <p>from which</p> <p>A fir, 6 ins. diam., bears S. 74¼° E., 24.2 ft. dist., mkd. 1/4 S21 BT.</p> <p>A tamarack, 21 ins. diam., bears N. 7¼° W., 7.3 ft. dist., mkd. 1/4 S20 BT.</p> <p>Deposit a magnet in a white plastic case at the base of the stainless steel post.</p> <p>Continue over broken E. slope.</p> <p>5306.62 Point for the cor. of secs. 16, 17, 20, and 21, at proportionate dist., there is no remaining evidence of the original cor.</p>
------	---

~~P 11~~ -9

UNION COUNTY SURVEYOR	
Date Received	<u>6/12/11</u>
Date Filed	<u>6/23/11</u>
By	<u>R. ROBINSON, Deputy</u>
File No.	<u>014-2011R</u>