### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

### History of original corner establishment:

1/4 corner common to Sections 13 & 14, T2N, R39E, W.M., Union County, Oregon

Original corner established in 1881 by R. Moore under contract No. 382 approved 3/23/1881. He set a post from which:
A Pine 16" diameter bears N44°E, 41 Lks. distance
A Pine 12" diameter bears N44°W, 54 Lks. distance

REGISTERED PROFESSIONAL LAND SURVEYOR

> OREGON JULY 13, 1979 R. A. SUTTON

RENGWAL 6/30/98

**T2N R39E** 

S14 S13 RLS 1848

1987

Description of corner evidence found:

No original corner evidence found. The following corner references were found: A stump hole with rotted remains of portion of blaze overgrowth bears N44°E, 41 Lks., A stump hole with a dead and down pine, open blaze, partially burned, faint scribing "S" with axe marks visible bears N44°W, 54 Lks.

Description of monument and accessories I established to perpetuate the original location of this corner:

I set a 5/8"x30" iron rod with a 1-1/2 inch aluminum cap marked: at S44°W, 41 Lks from the above described original Section 13 bearing tree evidence and S44°E, 54 Lks. from the above described original Section 14 bearing tree evidence from which:

A 9" Ponderosa Pine bears N59°E, 52.9' blazed & scribed (1/4S13BT)

A 12" Ponderosa Pine bears N8°45"W, 15.8' blazed & scribed (1/4S14BT)

Office of the County S	Surveyor County of	<u>Union</u>	שמותים בסיינודי
State of <u>Oregon</u> , I hereby	certify that the within instr	ument was filed in this of	fice Surviving
for record on the	day of	, 19	Deto Received 9/16/86
	by		
(COUNTY OFFICIA	AL) (DEPUT)	n	Date Filed 10/05/86  By Ly Da
			File No. 098-1996K

## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

# HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Rufus S. Moore under GLO contract number 382 dated March 23, 1881. Surveyor General field notes state:

Set Post

from which:

A Pine 16 ins. diam. bears N 44° E 41 lks dist A Pine 12 ins. diam. bears N 44° W 54 lks dist

Corner found by Bernard Sutton in 1987. Union County Survey record 041-1996 states:

No original corner evidence found. Found both references, A stump hole with rotted remains of portion of blaze overgrowth. A stump hole with dead and down pine, open blaze, partially burned, faint scribing "S" with axe marks visible.

At record distance and bearing he set a 5/8"x30" iron rod with 1 ½" aluminum cap marked as shown below,

from which:

A 9" Ponderosa Pine bears N59°E, 52.9' blazed and scribed 1/4S13 BT.

 $\overline{\text{A}}$  12" Ponderosa Pine bears N8°45'W, 15.8' blazed and scribed 1/4 S14 BT.

# S 13

T2N R39EL-21

## DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 5/8" iron pin, 9" above ground, bent South Easterly, with 1 ½" aluminum cap marked as shown below with a collar of stone 2' diam.

from which: A 16" Ponderosa Pine stump bears North 59° East, a dist. of 52.95 ft., with BT tag and

healed blaze. An approx. 16" stump bears North 44° West, a dist. of 35.65 ft., dead and down lying South Easterly with axe marks and paint.

A 18" Ponderosa Pine stump bears North 9° West, a dist. of 15.80 ft., with BT tag and healed blaze.

# DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

#### NEW BEARING OBJECTS:

A 4" Douglas Fir bears North 44° East, a dist. of 8.60 ft., marked 1/4S13 BT. A 3" White Fir bears South 7° East a dist. of 28.00 ft., marked X BT.

A 5" Douglas Fir bears South 28° West a dist. of 23.50 ft., marked 1/4S14 BT.

A 5" Ponderosa Pine bears North 47° West a dist. of 13.55 ft., marked 1/4S14 BT.

I hereby certify that the corner was perpetuated on May 17, 2019.

Set steel fence post approx. 1 ft. South

Witness: Kyle A. Tucker


REGISTERED **PROFESSIONAL** LAND SURVEYOR

June 2, 2010 JEFFREY S. HSU 83571

OREGON

Renewal Date: June 30, 2019

R39E T2N 1/4 S14|S13 1987 **RLS 1848** 

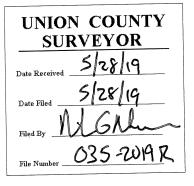

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 13° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees.  $\tilde{\mbox{\sc A}}$  brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.