
#### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

#### HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner monumented by Gregory Blackman in 1995. Union County Survey record 034-1995 states:

Set 5/8" x 30" rebar with 1" aluminum cap marked CW 1/16

North/East Fence corner bears North 11.7 ft. and West 21.1 ft.

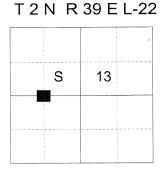

## DESCRIPTION OF CORNER EVIDENCE FOUND:

Found 5/8" iron pin, 7" above ground, with 1 ½" aluminum cap marked "CW 1/16" in collar of stone 2'. Falls approx.

10' South of fence corner. Bearing Tag on 22" Ponderosa

Pine with healed blaze states: CW 1/16 S69W 10.55. However I find the monument bears South 84° West, a dist. of 35.10 ft. from the found pin. Pin likely removed and reset from original position. From a position established by retracement of Survey 034-1995:

The 22" Ponderosa Pine bears North 69° East, a distance of 10.55 feet, alive and vigorous with healed blaze.

See Survey 011-2019

# DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At the position by survey I set a new 5/8"x30" iron pin, 25" in the ground, with 2 ½" aluminum cap marked as shown below, in collar of stone 2 ft. diam., from which:

### NEW BEARING TREES:

A 5/8" iron pin bears West a dist. of 25.00 ft., with 1 ½" aluminum cap marked CW 1/16 RM. A 6" Ponderosa Pine bears South 45° West a dist. of 43.50 ft., marked CW 1/16 S13 BT.

A fence corner from which fences bears North and East falls Northwest of monument approx. 30 ft...

Set steel fence post North approx. 1'.

I hereby certify that the corner was monumented on May 17, 2019. Witness: Kyle A. Tucker.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010

JEFFREY S. HSU
83571

Renewal Date: June 30, 2019

T2N R39E C T2N R39E C T2N C T2

UNION COUNTY
SURVEYOR

Date Received 5/28/19

Date Filed By 6/16

File Number 036-2019R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 13° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. The bearings are to a brass washer marked OPLS 83571 attached to the BT blaze of the new bearing trees.