

Date 2 FEB 86
 Line Staked 615 T25 R36E
 Project REFERENCE POINTS
 For 7/8 T25 R36E
 Party DONALD T
 FLORECHIAUER
 HUKARI


OREGON STATE HIGHWAY DIVISION
 TRANSIT SHEET
 Form 74-303

E-5

T25	SEC COR	615	T25	R36E
"	WEST 2	5D	"	4D
"A"	93°45'40"	288.815		288.19
"B"	93°54'00"	426.110		425.12
"C"	95°40'20"	224.600		213.50
"D"	95°29'00"	346.615		345.03

**UNION COUNTY
SURVEYOR**

Date Received 2-13-86
 Date Filed 3-10-86
 By G. Langstaff, Deputy
 File No. 1-86 R

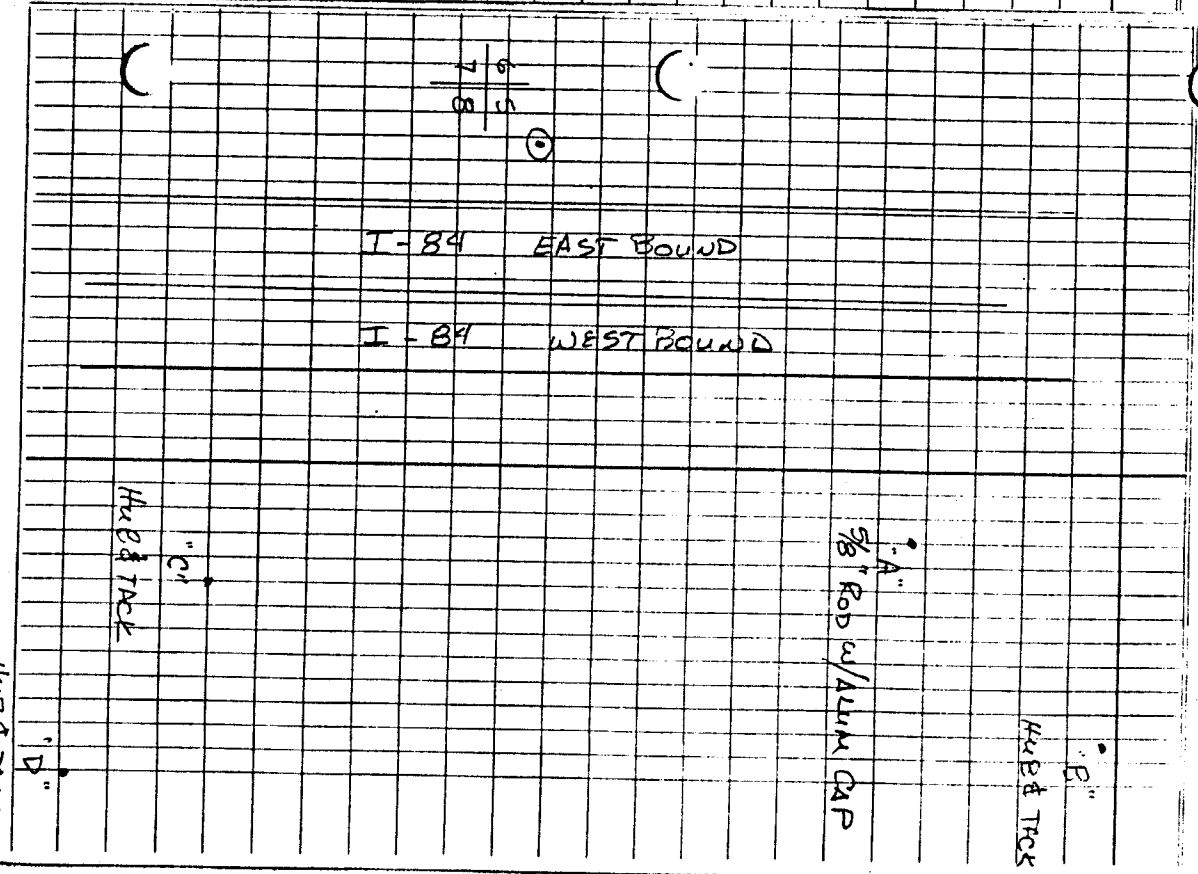

HUB & TACK

106-334

OREGON STATE HIGHWAY DIVISION
TRANSIT SHEET

Form 734-3033

E-5

REFERENCES	
FOE 6/5	T25 R34E
7/8	
7 FEBRUARY 1986	

FOR USE ONLY FOR THE SURVEYOR'S OFFICE


UNION COUNTY SURVEYOR	
Date Received	<u>2-13-86</u>
Date Filed	<u>3-10-86</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>1-86 R</u>

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner location was reestablished by survey as shown on County Record Survey 47-80. The corner monument and accessories established by Survey 47-80 are described in Union County Remonumentation Record 230-84R.


In February, 1986, in preparation for improvement work in the R/W of Interstate Highway I-84, a survey crew from the Oregon Dept. of Transportation established a series of reference marks for this corner position. This referencing is recorded in Remonumentation Record 1-86R.

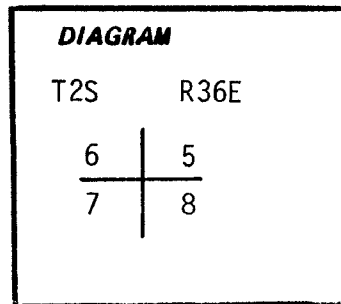

Description of corner evidence found:

The area of the corner has been cleared of all debris and stumps. The monument and fence post established in 1980 were found leaning against the westerly I-84 R/W fence. All traces of the actual corner position and accessories has been destroyed.

The reference points established and described in Record 1-86R were found in place and in good condition. We re-establish the position of the 1980 monument which is in agreement with the alignment and distances shown on Record 1-86R, except we find the distance to reference Pt. "D" to be 339.09 ft. instead of 345.03 ft. as recorded by the ODOT.

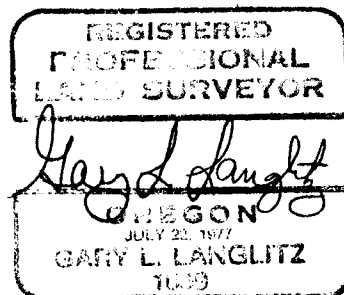


UNION COUNTY SURVEYOR
Date Received <u>6-12-86</u>
Date Filed <u>6-19-86</u>
By <u>G. LANGLITZ DEPUTY</u>
File No. <u>82-86 R</u>

Description of monument and accessories established to perpetuate the original location of this corner:

At the reestablished position of the 1980 corner to sections 5, 6, 7 and 8, we reset the 1980 monument, a 2"x30" Galvanized Iron Pipe, 26" in the ground, with brass cap attached, marked:

(Note: Monument markings added at this time "Reset 1986 PLS 1099")

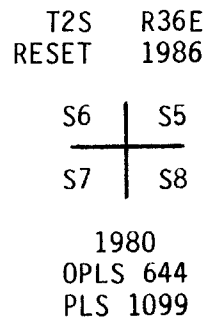

From which we mark two new bearing trees and note one bearing object:

- A 12" White Fir, scribed "T2S R36E S6 BT" on a double blaze, bears N71°W 125.7 ft.
- And a 12" Western Larch, scribed "T2S R36E S7 BT on a double blaze bears S22°W 120.8 ft.

A 5/8" Iron Rod with aluminum cap marked "Ore. State Hwy. Dept." shown as reference point "A" on Record 1-86R, bears N23°E 288.19 feet. (This bearing object is located on the Easterly side of I-84)

Attached brass washers marked "LS 1099" to lower blaze of each new BT. Magnetic Compass (20° East Declination) Steel Tape Placed steel fence post with "Attention" sign approx. 2 ft. North of reset monument. Corner is located approx. 50' west of the eastbound lanes of I-84.

June 4, 1986

Gary L. Langlitz, LS 1099
Deputy County Surveyor
Larry Baumberger


Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by.....
 (COUNTY OFFICIAL) (DEPUTY)

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1895 by Marius Buckunure under Government Land Office contract number 168.

E-5

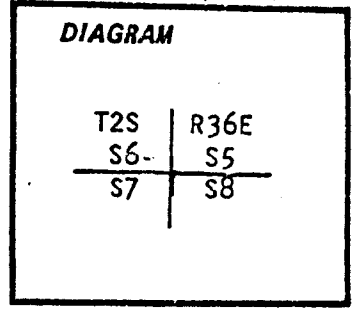

Surveyor General record states:

Set post for corner to sections 5-6-7-8 from which:

- A fir 9 in. dia. bears N55¹/₂E, 44 links
- A pine 10 in. dia. bears S86E, 15 links
- A pine 7 in. dia. bears S24¹/₂W, 8 links
- A pine 8 in. dia. bears N77W, 13 links

No record of subsequent remonumentation was found in County records.

Description of corner evidence found:

NONE

See map of survey dated 5/19/80

Description of monument and accessories I established to perpetuate the original location of this corner:

At double proportionate distance, I set a 2¹/₂ inch X 30 inch iron post with brass cap marked as shown, 27 inches in the ground from which:

NEW BTs


A 8 inch lodge pole pine bears N82E, 3.9 feet marked T2S R36E S5 BT

A 10 inch lodge pole pine bears S11E, 34.8 feet marked T2S R36E S8 BT

A 15 inch fir bears S77W, 38.2 feet marked T2S R36E S7 BT

A 13 inch fir bears N48W, 68.1 feet marked T2S R36E S6 BT

Raised mound of stone.

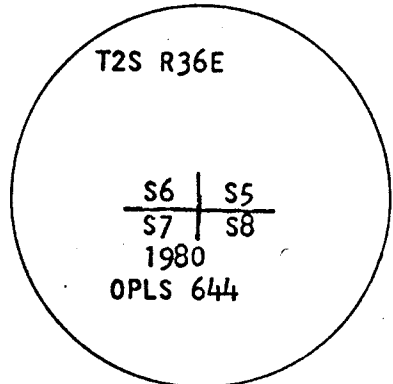

Brass washer nailed to B.T. blaze. Used steel tape and magnetic compass with 20° East declination Measured to center of B.T.s

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

Handwritten Signature

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY
SURVEYOR**


Date Received _____
★ GPO—798-276

Date Filed _____

By _____

File No. 230-84 R


FOUND 2 1/2" PIPE WITH
BRASS CAP MARKED:

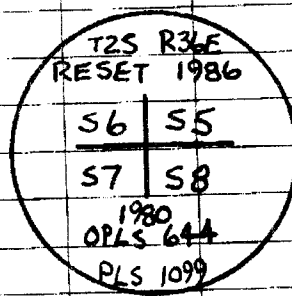

MAY 8, 1995

GREG BLACKMAN
RICK ROBINSON


NORTH

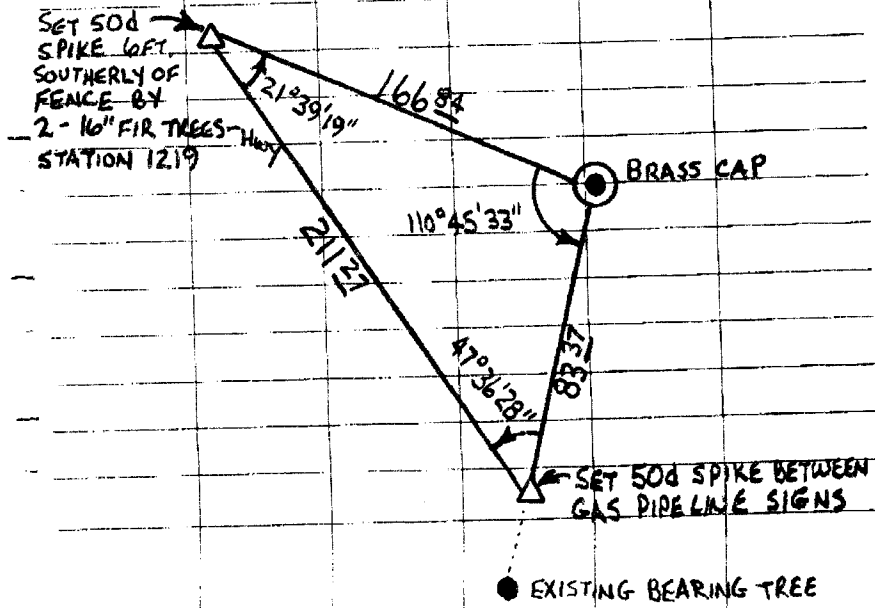

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Marius Buchanon under GLO contract number 635, dated April 19, 1895, Surveyor General record states:
 Set a Tamarack post 3' long 4" square 24" in the ground. From which;
 A 9" Fir bears N55½°E, 44 lks.
 A 10" Pine bears S86°E, 15 lks.
 A 7" Pine bears S24½°W, 8 lks.
 A 8" Pine bears N77°W, 13 lks.

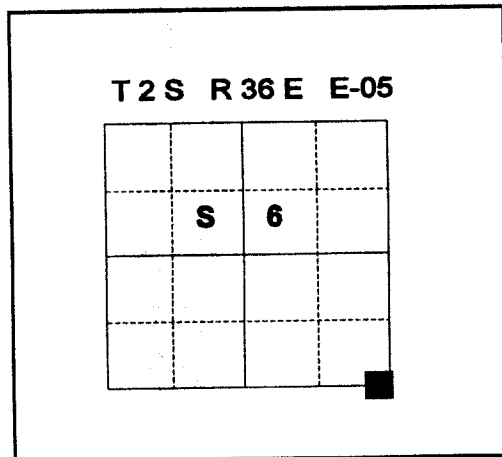

Survey 47-80 states setting a 2½" brass cap monument from which;
 A 8" Lodgepole Pine bears N82°E, 3.9 feet.
 A 10" Lodgepole Pine bears S11°E, 34.8 feet.
 A 15" Fir bears S77°W, 38.2 feet.
 A 13" Fir bears N48°W, 68.1 feet.

Monumentation sheet 1-86R states setting;
 Point "A" a 5/8" iron pin with aluminum cap at 288.19 feet.
 Point "B" a hub and tack at 425.12 feet.
 Point "C" a hub and tack at 223.50 feet.
 Point "D" a hub and tack at 345.03 feet.

Monumentation sheet 82-86R states finding the brass cap monument from survey 47-80 out of the ground and re-setting it, from which;
 A 12" White Fir bears N71°W, 125.7 feet.
 A 12" Western Larch bear S22°W, 120.8 feet.
 A 5/8" iron pin with OSHD aluminum cap bears N23°E, 288.19 feet.
 Point "D" of 1-86R is called at 339.09 feet.

Union County Surveyor notes state setting;
 A 50d spike at 166.84 feet. A 50d spike at 83.37 feet.

No subsequent monumentation found in Union County survey records.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found bearing trees as per 82-86R. Found 50d spikes as per Union County Surveyor notes.

See Union County Survey Number 043-1995.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

From found bearing trees and 50d spikes, I set a 2½"x30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground, from which;


NEW BEARING OBJECTS:

A 5/8" rebar w/aluminum cap bears N11°E, 7.76 feet, marked UNION COUNTY SURVEYOR RP S5


A 5/8" rebar w/aluminum cap bears S49°E, 16.41 feet, marked UNION COUNTY SURVEYOR RP S8

I hereby certify that the corner was monumented on October 24, 1995.

Witness: Mark Durbin, Jeff Madsen

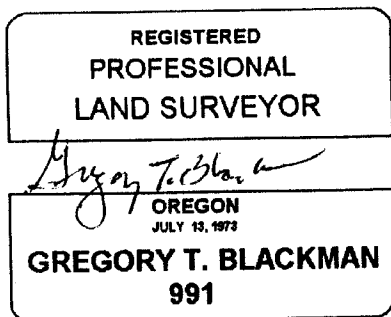

Renewal Date: December, 31 1995

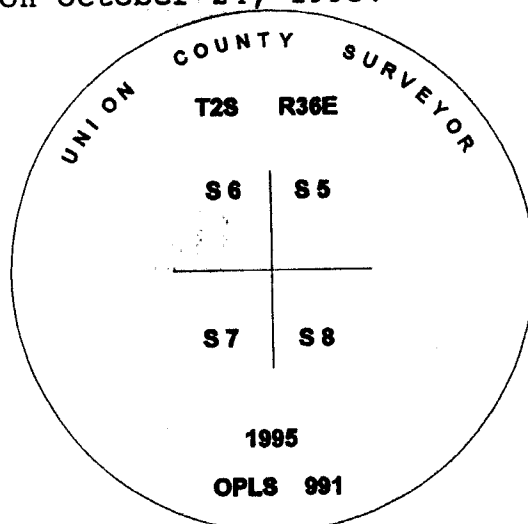

UNION COUNTY SURVEYOR

Date Received 11-13-95

Date Filed 11-13-95

Filed By J. Peterson, Deputy

File Number 037-1995R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination, the distances are to the center of aluminum cap of the bearing objects.

E-05