

1/4 CORNER 35 and 36

(T2SR36E)

ORIGINAL:

Stone (found disturbed at fence corner)
I used fence corner post

SECTION CORNER 25, 26, 35, & 36

ORIGINAL:

Stone (found in place)
24" Fir N65°W 56 LKS (not found)
12" Fir S20°W 42 LKS (now 28" "R36ES35" visible)
10" Fir S10°E 49 LKS (not found)
15" Fir N40°E 49 LKS (not found)

RESTORED:

Set 4" x 4" x 48" White post near stone
19" Fir S34°E 52.8 ft. scribed, "T2SR36ES36BTRS691"
8" Fir N81°W 60.7 ft. scribed, "T2SR36ES26BT"
12" Fir N57°E 34.3 ft. scribed, "T2SR36ES25BT"

Witnessed by: J. Hollingsworth
A. Slack
R. Hemmer
T. Stose

SECTION CORNER 25, 30, 31 & 36

ORIGINAL:

Stone (not found)
10" Fir N42°W 20 LKS (now down, scribe visible)
10" Pine N5°E 28 LKS (now 20")
24" Pine S2°E 8 LKS (now rotted stump)

RESTORED:

Set 5/8" x 30" iron pin 15" in ground.
Erected mound of stone around pin.
9" Fir N73 1/2°W 46.7 ft. scribed, "T2SR36ES25BT"
15" Fir S8°W 38.8 ft. scribed, "T2SR36ES36BT"
15" Fir S52°E 31.2 ft. scribed, "T2SR37ES31BT"
Yellow corner tag on SW BT.

Witnessed by: A. Slack
R. Hemmer
T. Stose

1/4 CORNER 36 and 31

ORIGINAL:

Post (not found)
10" Pine N23°E 55 LKS (not found)
10" Pine S30°W 58 LKS (now 23", scribe visible)

UNION COUNTY SURVEYOR

Date Received _____

Date Filed _____

By _____

File No. 312-84R

UNION COUNTY SURVEYOR

Date Received _____

Date Filed _____

By _____

File No. 313-84R

UNION COUNTY SURVEYOR

Date Received _____

Date Filed _____

By _____

File No. 314-84R

UNION COUNTY SURVEYOR

Date Received _____

Date Filed _____

By _____

File No. 315-84R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner originally established by John A. Hurlburt under GLO contract number 201, dated August 5, 1873. Surveyor General record states:

Set basalt stone 24x15x6, 10 in. in ground and made stone mound 2 ft. high for 1/4 sec. cor.

Corner position found and used by John E. Hollingsworth, OPLS 691 in 1969. His record states:

ORIGINAL: Stone (found disturbed at fence corner)
I used fence corner post.

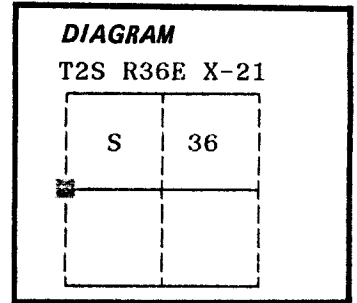

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found a stone 24x16x7 inches marked 1/4. Stone falls in rockjack with fences running South and West.

UNION COUNTY SURVEYOR	
Date Received	<u>8-22-89</u>
Date Filed	<u>8-22-89</u>
By	<u>G. LANGRISH, DEPUTY</u>
File No.	<u>155-89 R</u>

See map of survey dated June, 1989.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the Northeast corner of the rockjack, I set a 2 1/2" x 30" aluminum pipe with aluminum cap marked as shown, 26 inches in the ground, from which:

New Bearing trees:


- A 15 inch diameter Ponderosa Pine bears S61°E, 343.30 feet marked 1/4 S36 BT
- A 14 inch diameter Ponderosa Pine bears S81°W, 118.48 feet marked 1/4 S35 BT

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet South with land survey monument and property boundary signs attached.

Buried the original corner stone East and alongside of monument. Raised mound of stone around monument, 3 ft. base to top of cap.

I hereby certify that the above corner point was perpetuated as hereon described on May 5, 1989.

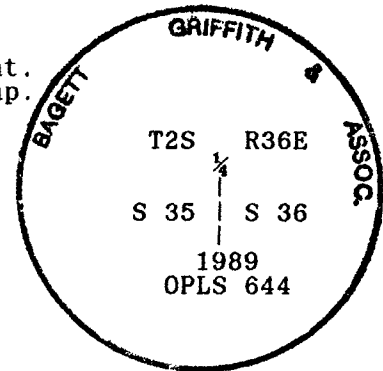

Witness: Rick Robinson

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

OREGON
JULY 10, 1954
DUANE I. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)