

~~Yellow corner tag on SW BT.~~

X-1

~~Witnessed by: A. Slack
R. Hemmer
T. Stose~~

1/4 CORNER 36 and 31

ORIGINAL:

Post (not found)
10" Pine N23°E 55 LKS (not found)
10" Pine S30°W 58 LKS (now 23", scribe visible)

(T2S R37E)

UNION COUNTY
SURVEYOR

Date Received _____

Date Filed _____

By _____

File No. 315-84R

RESTORATION BY J.E. HOLLINGSWORTH,
LS 691, 1969
(G. LANGLITZ, DEP. CO. SURVEYOR)

-3-

RESTORED:

Set 5/8" x 30" iron pin 24" in ground.
Set 4" x 4" x 48" white post near pin scribed,
"T2S R36E S36 E1/4COR"
13" Pine N84 1/2°E 27.5 ft. scribed, "T2SR37ES31BTRS691"
Yellow corner tag on original BT.

Witnessed by: A. Slack
R. Hemmer
T. Stose

~~E - E - 1/64~~

~~ESTABLISHED:~~

~~Set 5/8" x 30" iron pin
Set 4" x 4" x 48" white post near pin.~~

~~Witnessed by: E. Haury
D. Shaw
T. Stose~~

~~SE - SE - 1/64~~

~~ESTABLISHED:~~

~~Set 5/8" x 30" iron pin
Set 4" x 4" x 48" white post
10" Pine S40 1/2°W 45.6 ft. scribed, "SESE 1/64 BTRS691"~~

~~Witnessed by: E. Haury
D. Shaw
T. Stose~~

~~C - N - SE - SE 1/256~~

~~ESTABLISHED:~~

~~Set 5/8" x 30" iron pin.
Set 4" x 4" x 48" white post near pin.
10" Pine S42°W 67.6 ft. scribed, "CNSESE 1/256 BTRS691"~~

~~Witnessed by: E. Haury
D. Shaw
T. Stose~~

WITNESS CORNER (304.59 ft. S89°27'E of C-N-SE-SE 1/256)

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner established by John A. Hurlburt under GLO contract no. 201 dated August 5, 1873.

Surveyor General records state:

Set pine post 4 ft long 3 ins thick 2 ft in ground for 1/4 Sec Cor

A pine 10 ins diam N 23° E, 55 lks

A pine 10 ins diam S 30° W, 58 lks

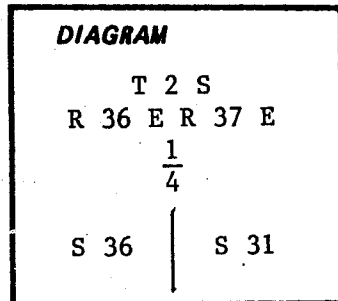

Description of corner evidence found:

Original post corner not found.

A pine 24 ins diam for Sec 36 original bearing tree previously opened and alive with scribes..4 S..on partially healed and burned blaze.

Found a 1 inch diam solid iron rod in approximate corner position set by persons unknown(County survey records show iron rod as found)


Found a pine 13 ins diam marked T 2 S R 37 E S 31 BT RS 691 established by John E. Hollingsworth for the Oregon State Parks & Recreation Division.

Found a 4" x 4" x 48" wood post alongside above mentioned iron rod.

Description of monument and accessories established to perpetuate the original location of this corner:

At position established from the original Section 36 bearing tree set a 2½ inch brass cap on a 2 inch iron pipe 31 inches long and projecting 6 inches out of the ground with a surrounding rock mound and a 6 foot steel fence post alongside with a sign 54-4 attached.

Brass cap marked thus:

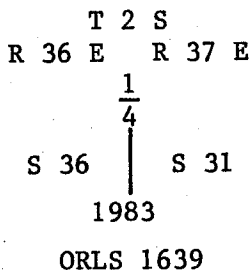

The bearing tree established by Hollingsworth is a pine 13 ins diam which bears N 79° E, 26.6 ft dist marked T 2 S R 37 E S 31 BT RS 691..

The original bearing tree bears S 30° W, 58 lks (38.3 ft) marked ...4 S.. on partially healed and burned blaze.

Attached a sign 54-3 below a 6 inch band of red paint and a sign 54-4 on opposite side of tree from BT blaze to each of the existing bearing trees.

I hereby certify that the above described corner monument was properly maintained to Forest Service standards by me on Nov. 7, 1983, and witnessed by Jim DeMastus.

REGISTERED PROFESSIONAL LAND SURVEYOR

William L. Hanley

OREGON JULY 14, 1978 WILLIAM L. HANLEY 1639

Office of..... County Surveyor County of..... Union
State of..... Oregon I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR
Date Received 11-10-83
Date Filed 11-14-83
By G. LANGLITZ DEPUTY
File No. 386-83 R