

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

(T2S R38E)


History of original corner establishment:

Corner established by T. W. Davenport under GLO contract no. 102, dated July 20, 1863.

Surveyors General records state:

Set post corner to Secs. 1, 6, 31 & 36 of township Nos 1 & 2 South Ranges 37 & 38 East from which corner:

- A spruce 12 ins diam bears N 50° W, 5 lks.
- A spruce 18 ins diam bears S 75° W, 19 lks.
- A tamarack 12 ins diam bears S 70° E, 20 lks.
- A spruce 18 ins diam bears N 60° E, 8 lks.

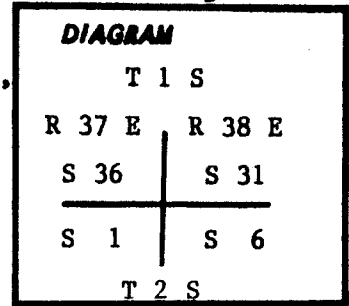

Description of corner evidence found:

Found a standing tamarack snag with full record scribes and old bearing tree tag attached for section 6 bearing tree.


Found a rotted stump for section 1 bearing tree, no visible scribes intact on rotten wood.

No trace of sections 31 and 36 bearing trees or of original wood post.

Description of monument and accessories established to perpetuate the original location of this corner:

At position determined from original bearing trees and official record notes set a 2½ inch brass cap on a 2 inch galvanized iron pipe 31 inches long and buried to a depth of 26 inches in the ground with 5 inches projecting out of the ground with a surrounding rock mound and a 6 foot steel fence post alongside with a sign 54-4 attached.

Brass cap marked thus:

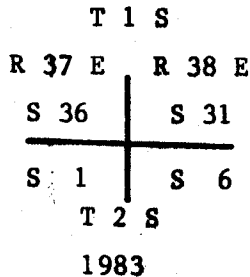

I hereby certify that the above described corner monument was properly established by me on July 22, 1983 and witnessed by Jim DeMastus.

REGISTERED PROFESSIONAL LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

New bearing trees:

ORLS 1639

- A spruce 8 ins diam bears N 70° E, 29.0 ft dist marked T 1 S R 38 E S 31 BT.
- A fir 12 ins diam bears N 45½° W, 60.0 ft dist marked T 1 S R 37 E S 36 BT.
- A fir 6 ins diam bears S 06° E, 35.3 ft dist marked T 2 S R 38 E S 6 BT.
- A fir 12 ins diam bears S 54° W, 53.4 ft dist marked T 2 S R 37 E S 1 BT.

NOTE: A fir 9 ins diam which bears S 30° E, 42.8 ft dist was blazed for bearing tree marks and upper blaze was scribed; lower blaze was in rotten wood and therefore scribes were removed and another tree selected for this bearing tree.

Each new bearing tree has a sign 54-3 nailed below a 6 inch band of red paint and has a brass washer marked PLS 1639 nailed flush with BT blaze and a sign 54-4 is nailed on the opposite side of the tree from the BT blaze.

Office of..... County Surveyor..... County of..... Union.....
 State of..... Oregon....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by.....
 (COUNTY OFFICIAL)

UNION COUNTY SURVEYOR
 (DEPUTY)

Date Received 8-15-83
 Date Filed 8-18-83
 By C. Langwitz, Deputy
 File No. 315-83 R

T. 1 S., R. 38 E., Willamette Meridian, Oregon

FEET

remonumented at proportionate positions based on the official record. The retracement data were thoroughly verified and only the true line field notes are given herein.

Each new bearing tree has a 2½ inch x ¼ inch magnetic nail (Mag Nail) driven at the base on right side center, unless otherwise noted in the corner description.

The geographic position (NAD 1983 (98)) of the corner of sections 19, 20, 29, and 30, as determined by direct GPS occupation, by the Bureau of Land Management, in 2003, utilizing National Geodetic Survey Online Positioning User Service (OPUS) and CORS stations Appleton, Spokane 1, and Missoula ARPs, is as follows:

Latitude: 45° 27' 22.947" N. Longitude: 118° 05' 48.047" W.

Dependent Resurvey of the West Boundary,
T. 1 S., R. 38 E., Willamette Meridian, Oregon

(Restoring the survey by Timothy W. Davenport in 1863)

Beginning at the cor. of Tps. 1 and 2 S., Rs. 37 and 38 E., perpetuated by William L. Hanley, Registered Professional Land Surveyor No. 1639, in 1983, recorded in the Union County Survey records, survey file No. 42-83, monumented with an iron post, 2½ ins. diam., firmly set, projecting 2 ins. above a collar of stone, with brass cap mkd.

T 1 S	
R 37 E	R 38 E
S 36	S 31
S 1	S 6
T 2 S	
1988	
ORLS 1639	

from which the remains of an original bearing tree

A sawed tamarack stump, 20 ins. diam., bears S. 70° E., 13.2 ft. dist., with no marks visible.

and the remains of bearing trees mkd. by Hanley

**UNION COUNTY
SURVEYOR**

Date Received 6/12/11

Date Filed 6/23/11

By R. ROBINSON, DEPUTY

File No. 027-2011R

Z-1

Dependent Resurvey of the West Boundary,
T. 1 S., R. 38 E., Willamette Meridian, Oregon

FEET	
	<p>A root hole, bears N. 72½° E., 28.1 ft. dist., with uprooted fir, 9 ins. diam., alongside, with fragmentary scribe marks visible on partially decayed open double blazes.</p> <p>A fir, 8 ins. diam., bears S. 4¼° E., 35.2 ft. dist., with healed double blazes.</p> <p>A root hole, bears N. 45¼° W., 59.7 ft. dist., with uprooted fir, 13 ins. diam., alongside, with scribe marks T1S R37E S36 BT visible on open double blazes.</p> <p>and new bearing trees</p> <p>A fir, 15 ins. diam., bears N. 32° E., 76.3 ft. dist., mkd. T1S R38E S31 BT.</p> <p>A fir, 22 ins. diam., bears S. 27½° W., 47.0 ft. dist., mkd. T2S R37E S1 BT.</p> <p>A spruce, 12 ins. diam., bears N. 78¼° W., 43.7 ft. dist., mkd. T1S R37E S36 BT.</p> <p>A steel fence post is set alongside the cor.</p> <p>Corner is located W., 150 ft. dist. from a graveled road, 12 ft. wide, extending N. 15° W. and S. 15° E.</p> <p>N. 0° 01' 38" E., bet. secs. 31 and 36.</p>
	<p>Over broken W. slope, through fir, tamarack and pine timber.</p>
2655.24	<p>Point for the ¼ sec. cor. of secs. 31 and 36, at proportionate dist., there is no remaining evidence of the original cor., not monumented.</p>
	<p>Over W. slope.</p>
5310.48	<p>Point for the cor. of secs. 25, 30, 31, and 36, at proportionate dist., there is no remaining evidence of the original cor., not monumented.</p>
	<p>N. 0° 01' 38" E., bet. secs. 25 and 30.</p> <p>Ascend over SW. slope, through fir, tamarack and pine timber.</p>

2-1

UNION COUNTY SURVEYOR	
Date Received	<u>6/12/11</u>
Date Filed	<u>6/23/11</u>
By	<u>R. ROBINSON, DEPUTY</u>
File No.	<u>027-2011R</u>