


UNION COUNTY SURVEYOR

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner not originally established by GLO Contract. Survey Number 8-75 set a 5/8" iron pin at a fence jack with "K tag" With the note on the map that positions of the survey are based on the best available evidence and is to be agreed to by adjoining parties. No agreement was ever made or filed.

No record of subsequent monumentation found in the Union County monumentation records

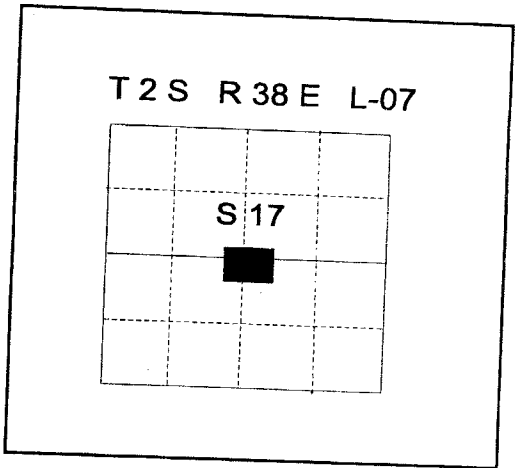

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found 5/8" pin set by survey number 8-75, 7.19 ft. South and 13.97 ft. East of the true corner position.

See Survey Number 042-2001

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position determined by survey, I set a 2 1/2" x 30" aluminum pipe with aluminum cap marked as shown below, 26" in the ground, from which;

NEW BEARING TREES:

- A 12" diameter Ponderosa Pine bears North 5°40' East, a distance of 82.15 feet marked X BT.
- A 11" diameter Ponderosa Pine bears North 77°46' East, a distance of 21.73 feet, marked C1/4 BT.
- A 18" diameter Ponderosa Pine bears South 36°42' West, a distance of 28.26 feet, marked C1/4 S17 BT.
- A 13" diameter Ponderosa Pine bears North 88°08' West, a distance of 32.61 feet, marked C1/4 S17 BT.

Raised mound of stone around monument, 1 ft. base to top of cap. I hereby certify that the corner was monumented on November 8, 2001. Witness: Norbert W. Volny and Gregory T. Blackman Jr.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Rick G. Robinson

OREGON
July 17, 1986

RICK G. ROBINSON
2219

Renewal Date December 31, 2002

BAGETT - GRIFFITH & BLACKMAN

T 2 S R 38 E

C 1/4 S 17

2001
OPLS 2219

UNION COUNTY SURVEYOR

Date Received 11/29/01

Date Filed 12/05/01

Filed By *Gregory T. Blackman*

File Number 046-2001R

I used a total station instrument in the establishment of the new accessories. The basis of bearing is the same as survey number 042-2001. The distances are to a 60d spike driven into the right side of the root crown of the bearing tree. I attached a brass washer marked OPLS 2219 to the BT blaze.