

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

C-17

History of original corner establishment:


Corner established by Henry Meldrum under GLO Contract No. 450 and dated June 11, 1882.

Surveyor General records state:

Set post 3 ft long 3 in square 24 in in ground for 1/4 Sec Cor marked 1/4S on W face from which:

A tamarack 9 in diam bears S37°E, 17 lks dist marked 1/4S BT.

A tamarack 24 in diam bears N80°W, 4 lks dist marked 1/4S BT.

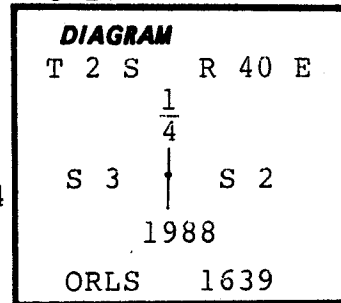

Description of corner evidence found:

Did not find wood post.

A western larch snag tree 18" diam mkd. "1/4S" on upper blaze & "BT" on lower blaze brs N80°W, 4 lks dist per record from reestablished corner position. The root hole of a western larch windblow 11" diam mkd "1/4S" on upper blaze and "BT" on lower blaze brs S31°E, 14.0' from reestablished corner position (record, S37°E, 17 lks).

A location tag on a 6" diam white fir dated 9-17-56 and initials LS & RRT brs S88 1/2°E, 5.3' dist from reestablished corner position.

NOTE: The reversed record bearing and distance from the standing section 3 BT and the section 2 BT root hole results in two corner positions which are 3' apart. The standing section 3 BT was determined to be most reliable and was therefore used to reestablish the original corner position. Additionally, the creek recorded to be 1.25

Description of monument and accessories established to perpetuate the original location of this corner: chains (82.5') north of the reestablished corner position was measured to be 142' north.

At position established by reversed record bearing and distance from standing section 3 BT...

Set a 2"x30" aluminum pipe with 2 1/2" aluminum cap attached 25 inches in ground with surrounding earthen mound & a steel fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A spruce 10" diam brs S58°E, 18.8' dist mkd 1/4S2 BT.

A spruce 14" diam brs S69°W, 42.6 ft dist mkd 1/4S3 BT.

Each BT has a sign 54-3 & 54-9 attached below a 6" band of red paint, and each new BT has a brass washer marked PLS 1639 nailed flush with BT blaze.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly remonumented by me and witnessed by Bill Gohring on June 22, 1988.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

William L. Hanley

**OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639**

Office of... County Surveyor..... County of... Union.....

State of... Oregon....., I hereby certify that the within instrument was filed in this office

for record on the..... day of....., 19.....

..... by

(COUNTY OFFICIAL)

(DEPUTY)

**UNION COUNTY
SURVEYOR**

Date Received 9-22-88
*GPO-591-971, 1988

Date Filed 9-23-88

By G. LANGLITZ, DEPUTY

File No. 133-88R

C-17