
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Henry Meldrum under GLO contract No. 450 and dated June 11, 1882. Surveyor General records state: A pine post 4' long 4" square 24" in ground for Cor to Secs 12,13,7 & 18 mkd T2SR40ES12 on NW, R40ES13 on SW, R41ES18 on SE and S7 on NE with 4 notches on S and 2 on N edges from which: A 16" pine brs N27°E, 32 lks mkd S7 BT. A 10" fir brs N38°W, 25 lks mkd T2SS12 BT. A 8" fir brs S62°W, 4 lks mkd R40ES13 BT. A 7" fir brs S78°E, 62 lks mkd R41ES18 BT.

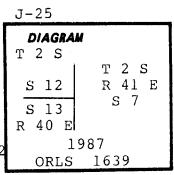

Corner MODIFIED by Alonzo Gesner under contract No.683 and dated June 07, 1898, and his records state: Found original post marked and witnessed as stated by the U.S. Surveyor General. I obliterated marks on the NE and SE faces of post, also obliterated marks on the bearing trees in Secs 7 and 18. I marked the NW face of post T 2 S.

Description of corner evidence found:

Found a rotten and burned remains of wood post from which: A spruce 20' dia brs $\rm N40^OW$, 15.6'(record, $\rm N38^OW$, 25 lks) with healed blaze. A rotten pine windblow & root stub brs $\rm N27^OE$, 17.5'(record, 32 lks) with visible axe work on rotten blaze. A rotten fir windblow & root stub brs $\rm S78^OE$, 41.4'(record,

62 lks) with visible axe work on rotten blaze. A rotten fir windblow & root hole brs S42 W, 3.8'(record, S62 W, 4 lks) no marks identified.

Date Filed 8-24-87 By G. Languitz Doroty File No. 58-87 R

Description of monument and accessories I established to perpetuate the original location of this corner:

At position of found original post...

Set $2\frac{1}{2}$ " aluminum cap on 2" aluminum pipe 25" in ground with 5" projecting out of ground with surrounding rock mound and 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing tree established: A spruce 13" diam brs $S74^{O}W_{r}$ 31.3' dist mkd T2SR40ES13 BT.

Each BT has a sign 54-3 and signs 54-4 or 54-9 attached below a 6 "band of red paint, and each new BT has a brass washer marked PLS 1639 nailed flush with BT blaze.

Compass declination 190 East.

I hereby certify that the above described corner monument was properly remonumented by me and witnessed by Jim DeMastus on July 20, 1987.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 14, 1978
VILLIAM L. HANLEY
1639

. Honly

Jin	DeMadra	William 2
		OREGO JULY 14, 15
		WILLIAM L. H

Office of	County Surveyor	County of Baker	
		that the within instrument was filed in this office	
for record on the day of , 19			
		by	
	(COUNTY OFFICIAL)	(DEPUTY)	