## HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Henry Meldrum in GLO contract number 450, dated June 11, 1882. Surveyor General field notes state:

Set Basalt Stone  $18\times8\times6$  ins. in stony ground, and piled stone mound. Cor marked 1/4 on N face and raised a mound of stone alongside.

Corner recovered in Old Book Survey 71 (Page 144) dated 1889. Type of monument not mentioned.

 s	16	

T2S R40EN-11

1883. Type of monument not mentioned.

**Description of corner evidence found:** None. A fence corner falls relatively harmoniously with corner position in the North/South direction. Fence corner is an old and downed rock jack.


SEE SURVEY NUMBER 014-2016


## DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At fence corner position, I set a  $5/8" \ge 30"$  iron pin with 2  $\frac{1}{2}"$  aluminum cap, marked as shown below, 20 inches in the ground, to bedrock, from which:

NEW BEARING OBJECTS: A 5/8" x 15" iron pin bears North 37°59' East, a distance of 15.38 feet, with 1 ½" aluminum cap marked BGB SURVEY MARKER NE RP. A 5/8" x 15" iron pin bears South 66°29' East, a distance of 15.00 feet, with 1 ½" aluminum cap marked BGB SURVEY MARKER SE RP. A 5/8" x 15" iron pin bears South 66°55' West, a distance of 20.45 feet, with 1 ½" aluminum cap marked BGB SURVEY MARKER SW RP. A 5/8" x 15" iron pin bears North 54°42' West, a distance of 19.12 feet, with 1 ½" aluminum cap marked BGB SURVEY MARKER NW RP.

Corner falls on the South side of a rock jack fence corner. I hereby certify that the corner was monumented April 27, 2016.

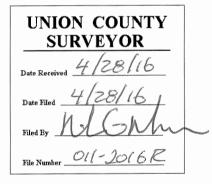

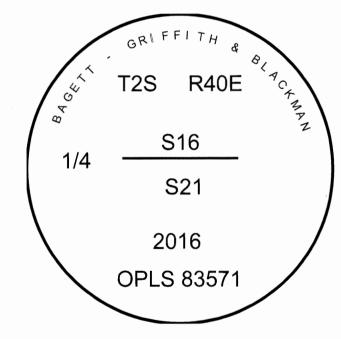



Renewal Date: June 30, 2017

I used a Leica GS15 RTK GPS in the establishment of the accessories. Basis of bearings is as per Survey Number 014-2016. Distances are to the center of the aluminum caps.

