


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original survey by Meldrum, Contract No. 450, 1882;

Set a basalt stone 18x12x4 ins. in a mound of stone for cor. to Sections 15, 16, 21 and 22, marked with 3 notches on S and E edges, from which:

- A Pine 18 in. dia. bears S42°W 132 lks. dist. marked S21 BT.
- A Pine 9 in. dia. bears S40°E 75 lks. dist., marked S22 BT.
- A Pine 18 in. dia. bears N20°W 40 lks. dist., marked R40E S 16 BT
- A Pine 30 in. dia. bears N50°E 121 lks. dist., marked T2S S15 BT.

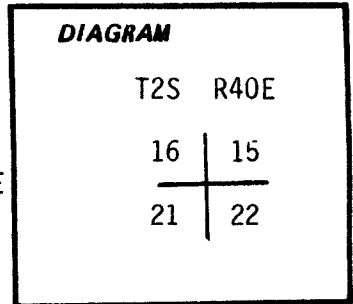

Description of corner evidence found:

Found a basalt stone 12x12x4 firmly set on a steep South slope with 3 distinct chiseled grooves on the South face and 3 distinct chiseled grooves on the West face. There are no other apparent markings on the stone. We find the original bearing trees and remains as follows:

A 36" Ponderosa Pine, alive and in good condition, with well-healed scar facing the corner position, partially opened by previous visitors, no markings visible, bears S45°W 83.0 ft. (to face of tree).

A rotted Ponderosa Pine stump, broken at ground level, size indeterminate, no markings found, bears S40°E 48.4 ft.

An area of rotted Pine wood and bark bears approximately N16°W 26 feet.

A 36" Ponderosa Pine snag, standing, no bark or scar present, no markings visible bears N48°E 75.3 ft. (to face of tree)

The stone mound has disappeared.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the position of the found marked stone, which we accept as the position of the original corner, we set a 2"x30" aluminum pipe, 30" in the ground and surrounded by a small mound of stone, with aluminum cap attached, marked:

The found corner stone is buried along the North side of the aluminum pipe.

We mark the following new bearing trees:

A 14" Ponderosa Pine, scribed "T2S R40E S15 BT" on a double blaze, bears N78°E 25.9 ft.,

A 14" Ponderosa Pine, scribed "T2S R40E S16 BT" on a double blaze bears N45°W 41.7 feet,

A 10" Douglas Fir, scribed "T2S R40E S22 BT" on a double blaze bears S22°E 22.4 ft.

Attached brass washer marked "LS 1099" to lower blaze of new bearing trees.


Magnetic Compass (20° East Declination)

Steel Tape

April 24, 1986

Gary Langlitz, LS 1099  
Deputy Union County Surveyor  
Kevin Leckenby

UNION COUNTY SURVEYOR  
T2S R40E

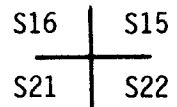

PLS 1099  
1986

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Gary Langlitz*  
REGON  
JULY 22, 1977  
GARY L. LANGLITZ  
1089

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office

for record on the..... day of....., 19.....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY SURVEYOR**

Date Received 5-21-86

Date Filed 5-22-86

By G. LANGLITZ, DEPUTY

File No. 40-86 R