


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T-25

History of original corner establishment:

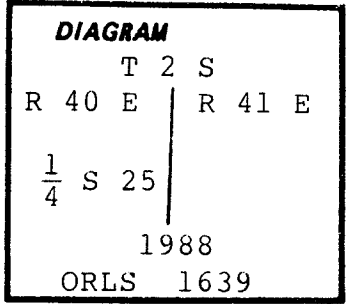

Corner originally ESTABLISHED by Henry Meldrum under GLO contract No.450 and dated June 11,1882.

Surveyor General records state:

Set post 4 ft long 3 in square 24 in in ground for 1/4 Sec Cor marked 1/4S on W face from which:

A pine 9 in diam bears S87°E, 25 lks dist marked 1/4S BT.

A fir 20 in diam bears N72°W, 38 lks dist marked 1/4S BT.

Corner REESTABLISHED by Alonzo Gesner under GLO contract No.683 dated June 7, 1898, during his resurvey of the east boundary of T.2S.,R.40E.,W.M...

The 1/4 Sec Cor which had been destroyed by forest fires I established the Cor as follows: Set basalt stone 18x14x6 in 12 inches in ground marked 1/4 on the W side from which: A dead snag 12 ft high 20 in diam brs N72°W, 38 lks dist marks imperfect, I marked: A pine 4 in diam brs N2°30'E, 42 lks dist mkd 1/4S BT. A pine 4 in diam brs N62°30'W, 20 lks dist mkd 1/4S BT.

Description of corner evidence found:

Searched 6 man-hours total on 6-09-88, 8-07-88 & 8-16-88 in old burn and windblow area - stone and accessories not found and corner declared lost.

UNION COUNTY SURVEYOR	
Date Received	<u>6-8-89</u>
Date Filed	<u>6-9-89</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>119-89 R</u>

Description of monument and accessories I established to perpetuate the original location of this corner:

At proportioned position on line between NE & SE corners to Section 25...

Set 2½" aluminum cap on 2" x 30" aluminum pipe 24" in ground to bedrock & surrounded with mound of earth & stone. Set 6" steel fence post alongside corner with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A white fir 10" diam brs N21½°W, 24.5' dist mkd 1/4S25 BT.

A white fir 9" diam brs S44°W, 24.8' dist mkd 1/4S25 BT.

New bearing trees have a brass washer stamped PLS 1639 nailed to face of blaze. Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 19° East.

I hereby certify that the above corner monument was properly REESTABLISHED to U.S.F.S. standards by me on August 17, 1988 and witnessed by Jim DeMastus.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1979
WILLIAM L. HANLEY
1639

Office of.....County Surveyor..... County of.....Union.....
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)