CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Z-7

History of original corner establishment:

Corner was originally established by Deputy Frank W. Campbell in 1884 under contract #507.

Set: Tamarack post 3' long, 3" square 18" in ground.

18" Tamarack N63W, 16 1ks.. 12" Tamarack S23E, 26 1ks. Marked:

DIAGRAM	9777 778 A. (1904 — Land V.), Arial
1/4	<u>S32</u> S5

Description of corner evidence found:

Searched for-not found.

Description of monument and accessories I established to perpetuate the original location of this corner:

T4N R40E At proportion set $2\frac{1}{2}$ "x30" alum. pipe with a 3" alum. cap <u>S32</u> S5 24" in ground in notched root of 20" Wh. Fir. Stamped: 1/4

Marked:

T3N

18" D-Fir N64¼W, 16.1' Scribed 1/4 S32 BT.

1994 20" Wh. Fir S38½W, 11.1' Scribed 1/4 S5 BT.

14" Wh. Fir N6E, 19.6' Scribed 1/4 S32 BT.

LS 896

REGISTERSO


PROPESSIONAL LAND SLYEVEYOR

25" Larch S80 3/4E, 61.5' Scribed 1/4 S5 BT.
Nailed 54-3 and 54-9 signs to BT's, painted bands and blazes red and nailed a 1" brass disk stamped PLS 896 flush between the B and the T. Set guard posts East and West with 54-2 signs, one with 54-9 sign.

Dec. 20.

Witnesses: Norman Larson and Carole Bishop.

Work was done in June 1994.

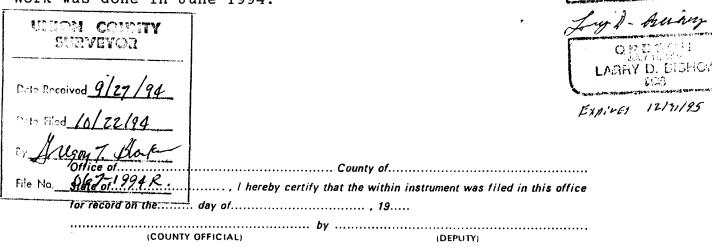

Form R6-7100-57 (9/71)

GPO--798-276