

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Herman Gradon under GLO contract number 517 dated Sept. 30th, 1884. Surveyor General field notes state:

Set a basalt stone 15 x 10 x 8, from which:
A Pine 24 in. diam. bears S81°W 6 lks. dist. marked 1/4 SBT.
A Pine 24 in. diam. bears S84°E 19 lks. dist. marked 1/4 SBT.

Corner found and tied to by railroad right of way survey dated June 30, 1916.

T 3 N R 40 E P-09

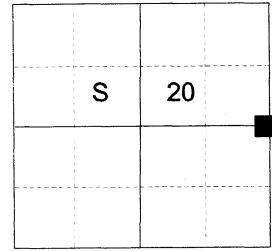

DESCRIPTION OF CORNER EVIDENCE FOUND:

None found. Area has been logged extensively with evidence of wildfires in the area.

SEE SURVEY 036-2020

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At surveyed position I set a 5/8" x 30" iron pin, drilled 28" in the ground, with 2 1/2" aluminum cap marked as shown below and in a 2' diam. collar of stone, From which:


NEW BEARING OBJECTS:

A 5/8" x 30" iron pin bears North a dist. of 76.90 ft., with 1 1/2" aluminum cap marked N RP. (pin falls on South edge of East/West bearing forest road and is marked with a 6 ft. fence post.)
An 18" Ponderosa Pine bears South 86° East a dist. of 61.95 ft., marked 1/4 S21 BT.
A 12" Ponderosa Pine bears South 50° West a dist. of 27.15 ft., marked 1/4 S20 BT.
A 20" Ponderosa Pine bears North 79° West a dist. of 23.70 ft., marked 1/4 S20 BT.

Set steel fence post bears North approx. 1'

I hereby certify that the corner was monumented on October 15, 2020.

Witness: Kyle A. Tucker

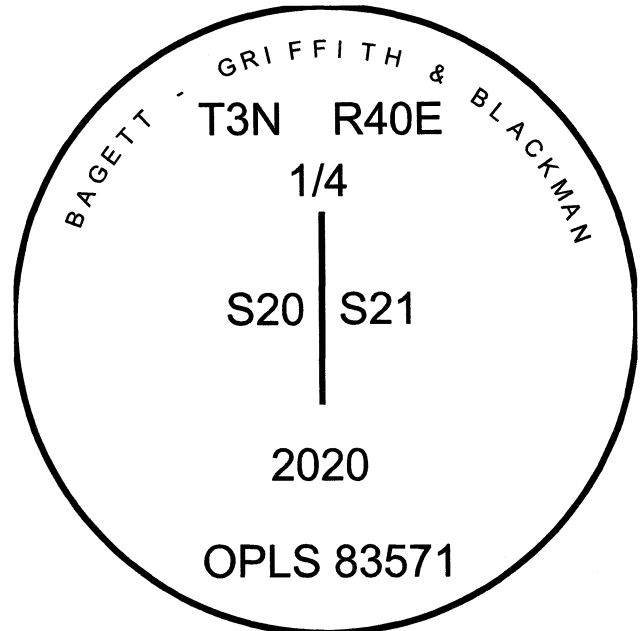

REGISTERED
PROFESSIONAL
LAND SURVEYOR

[Handwritten Signature]

OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2021

UNION COUNTY
SURVEYOR

Date Received 10/21/20

Date Filed 10/21/20

Filed By [Handwritten Signature]

File Number 030-2020

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.