RESTORED AND ESTABLISHED CORNERS

Section 36, Township 2 South, Range 36 East, W. M.

Hilgard Junction State Park

Union County

August 28, 1969


		Var. 20°				
TOWNSHIP CORNI	R, SECTIONS 36, 31, 1	and 6		UNION COUNTY SURVEYOR		
ORIGINAL:			-			
15" Fir S 18" Fir S	(Missing, found spike 36°W 31 LKS (not found 18°E 65 LKS (not found 54°E 89 LKS (not found	i) i).	cks)	Date Filed		
12" Fir N	62°W 52 LKS (not found	i} /	1	у		
RESTORED:			F	ile No. 308-84R		
Set 5/8" Set 4" x	s corner has existed f ls fit good, I will ac x 30" iron pin 26" in 4" x 48" post near pin by: A. Slack	cept this corner	of spike			
WIthessed	R. Hemmer		(T:	35 R 36E)		
	T. Stose		1	IION COUNTY SURVEYOR		
CORNER 36 an	11.			JURVETOR		
RIGINAL:			Date R	eceived		
Stone (found disturbed at fence corner) I used fence corner post			Date Filed			
ECTION CORNER 1, 2, 35 and 36:				E'e No. 310-84R		
RIGINAL:						
12" Pine 1	found) 128°E 98 LKS (now 26", 143°W 84 LKS (now 20", 182°W 99 LKS (now 25", 119½°E 535 LKS (now 22	scribe visible)	l.			
ESTORED:			1	UNION COUNTY SURVEYOR		
Set 4" x 4	30" iron pin 26" in 6" x 48" post near pin.	•	rs691"	Date Received		
	by: A. Slack			Date Filed		
	R. Hemmer		1	Ву		
	T. Stose			FIL No. 311-84R		

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John A. Hurlburt under GLO contract number 201, dated August 5, 1873. Surveyor General record states:
Set basalt stone 15x12x10, 8 in. in ground and made stone mound 2 ft. high for ½ sec. cor.

Corner position found and used by John E. Hollingsworth, OPLS 691 in 1969. His record states: ORIGINAL: Stone (found disturbed at fence corner) I used fence corner post.

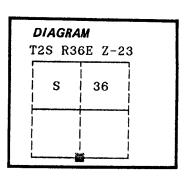


No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found a stone 17x9x6 inches marked $\frac{1}{4}$ Stone in rockjack with fences running South and West.

See map of survey dated June, 1989.

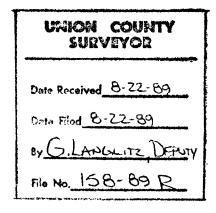

Description of monument and accessories I established to perpetuate the

original location of this corner: At the North edge of the rockjack, I set a $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown, 18 inches in the ground, from which:

New Bearing Tree and Bearing Object:
A 16 inch diameter Ponderosa Pine bears S31°E, 136.05 feet marked ½ S1 BT
A 3/4" diameter x 30" iron pipe with plastic cap marked BGA MARKER bears N49°W, 9.15 feet.


Painted a 6 inch red band around the BT and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet West with land survey monument and property boundary signs attached.

Buried the original corner stone West and alongside monument. Raised a mound of stone around monument, 3 ft. base to top of cap

I hereby certify that the above corner point was perpetuated as hereon described on May 5, 1989.

Witness: Rick Robinson

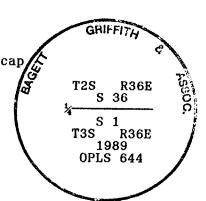

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964
DUANE I. GRIFFITH
644

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of	County of
State of	that the within instrument was filed in this office
	<i>bγ</i> (DEPUTY)

Form R6-7100-57 (9/71)

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner originally established by John A. Hurlburt under GLO contract number 201, dated August 5, 1873. Surveyor General records state: Set basalt stone 15"X12"X10", 8" in ground and made a stone mound 2' high for $\frac{1}{4}$ sec cor.

Corner position found by John E Hollingsworth, OPLS 691, in 1969. He states: stone found disturbed at fence

A - 23DIAGRAM T2S R36E S36 S1 T3S R36E 1988 OPLS 644

In 1989 Duane Griffith OPLS 644 found a stone 17"X9"X6" marked $\frac{1}{4}$ in a rock jack with fences running south and west. Se a $2\frac{1}{2}$ " X 30" aluminum pipe with aluminum cap 18" in the ground from which: A 16 inch diameter ponderosa pine bears S31°E, 136.05 feet marked $\frac{1}{4}$ S1 BT. A 3/4" diameter X 30" iron pipe with plastic cap marked BGA MARKER bears N49°W, 9.15 feet. See Union Co. File No. 158-89R.

Description of corner evidence found:

A $2\frac{1}{2}$ " X 30" aluminum pipe with a $2\frac{1}{2}$ " aluminum cap at a fence corner. Monument is surrounded with a mound of stone from which:

A 16" ponderosa pine bears S $32\frac{1}{2}^{\circ}$ W - 136.5 feet.

A 3/4" pipe with a yellow cap stamped "BGA marker" bears N 46° W - 9.1 feet.

Description of monument and accessories I established to perpetuate the original location of this corner:

Two new bearing trees established:

A 46" ponderosa pine bears N 23° E - 404.3' scribed " $\frac{1}{4}$ S36BT". A 44" ponderosa pine bears S 32° E - 371.0' scribed " $\frac{1}{4}$ S1 BT". The 46" ponderosa pine bearing tree has 4 approximately 16" ponderosa pines growing from the same stump. Set a 6' steel fence post 4 feet South of corner, attached sign 54-9 and

remounded stones.

Set a steel fence post along side of reference monument and attached sign 54-9 & 54-3.

New bearing trees have a brass washer stamped "PLS 1106" nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze and a red 6" band around each tree.

A Warren Knight staff compass and steel tape was used to tie bearing trees.

I hereby certify that the above corner monument was properly maintained to U.S.F.S standards by me on November 11, 1994.

Compass declination 18° East.

Witnessed by: Greg E. Flowers, LSIT Todd Rosenbalm

REGISTERED PRÓFESSIONAL LAND SURVEYOR

Wall R. Well OREGON

JULY 22, 1977 WILLIAM R. WELLS 1106

		•		
Office of	County of	ur jun e e	renews	6/30/98
State of	, I hereby certify that the within instrument wa	s filed in this	offic e	

for record on the...... day of...... , 19..... by

(COUNTY OFFICIAL)

Form R6-7100-57 (9/71)

(DEPUTYSURVEYOR

Date Received 7-10-96

☆ GPO-798-276