


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original survey by David P. Thompson, Contract No. 103, September, 1863.

- Set a post for corner to Sec's 29, 30, 31 and 32 from which:
- A Pine 36 in. diam. bears N33°W 89 lks. dist.
- A Pine 15 in. diam. bears N22°E 111 lks. dist.,
- A Pine, 4 in. diam. bears S78°E 26 lks. dist.,
- A Pine, 24 in. diam. bears S15°W 107 lks. dist.

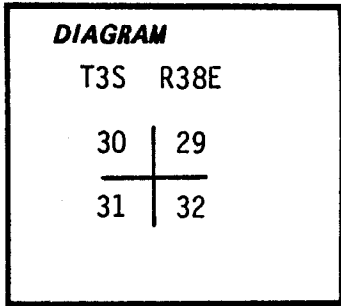

Description of corner evidence found:

We find the remains of the original SW bearing tree, a 24" Ponderosa Pine stump, partially rotten, with scribing "BT" visible on the lower blaze, unhealed and partially burnt with axe notch.

At the record position of the original NE bearing tree, we find the remains of a tree, rotted to ground level. We are unable to identify these remains as the original NE bearing tree.

We are unable to recover any evidence of the original NW and SE bearing trees or the original corner post.

Description of monument and accessories established to perpetuate the original location of this corner:

At the original corner position determined at the record bearing and distance from the original SW bearing tree, we set a 2"x30" aluminum pipe, 26 inches in the ground, supported in a mound of stone 4 feet diameter, with aluminum cap attached, marked:

From which:

The original SW bearing tree, a 24" Ponderosa Pine stump, previously described, bears S15°W 70.6 feet.

We mark new bearing trees:

A 16" White Fir, scribed "T3S R38E S31 BT" on a double blaze, bears S56°W 9.3 feet,

A 14" Douglas Fir, scribed "T3S R38E S30 BT" on a double blaze, bears N40°W 16.6 feet,

A 12" Douglas Fir, scribed "T3S R38E S29 BT" on a double blaze bears N42½°E 56.9 feet,

A 14" Douglas Fir, scribed "T3S R38E S32 BT" on a double blaze, bears S57½°E 15.7 feet.

Attached brass washer marked "LS 1099" to lower blaze of new BT's.

Magnetic Compass (20° East Declination).

Steel Tape.

Corner is located along the remnants of an old E-W fence.


The existing and newer E-W fence is located approximately 65 feet south from the corner.

June 10, 1985

Gary L. Langlitz, LS 1099
Mary Lewis, Forester, Boise Cascade Corp.
Stan Wilde, Forester, Boise Cascade Corp.

| | |
|-----|------|
| T3S | R38E |
| S30 | S29 |
| S31 | S32 |

PLS 1099
1985

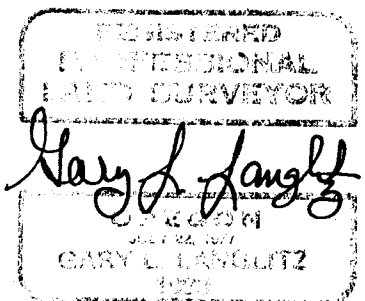

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Date Received 6-19-85

Date Filed 6-19-85

By G. Langlitz, DEPUTY

File No. 43-85 R