


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by William B. Barr under GLO contract Number 388, dated May 7, 1881. Surveyor General record states:

Set a basalt rock 16 x 12 x 8 ins. from which;
 A Pine 12 ins. dia. bears S38°W, 23 lks.
 A Fir 36 ins. dia. bears N 74°E, 59 lks.

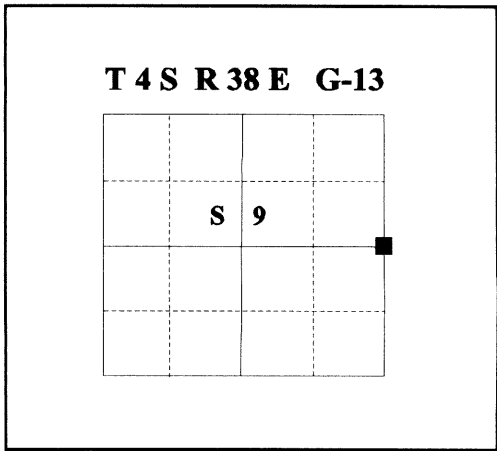

No record of subsequent monumentation found in Union County survey records.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a basalt rock 18x10x9 inches marked 1/4 in a small mound of stone.
 Found a stump hole with remains of a burned and rotted pine, at record position of the SW BT. There are no remains of the NE bearing tree.
 Found a State Board of Forestry K tag 5± ft. northeasterly.
 Found a 50d spike under the stone.

Found the Miller monument SE 62± feet

See map of Survey No. 037-1995, filed in the office of the Union County Surveyor.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:


In place of stone I set a 2½" x 30" aluminum pipe with aluminum cap marked as shown, 27 inches in the ground with small mound of stone, from which;

NEW BEARING TREES:


A 11 inch Tamarack bears N 58° E, 21.58 feet, marked 1/4 S10 BT
 A 11 inch Tamarack bears S 88° E, 47.22 feet, marked X BT
 A 11 inch Tamarack bears N 30° W, 20.00 feet, marked XX BT
 A 24 inch Ponderosa Pine bears N 63° W, 27.28 feet, marked 1/4 S 9 BT

Buried stone north.
 Drove steel fence post 5± FT. North.
 There is a E-W fence line 15 ft. south.

I hereby certify that the corner was monumented on July 26, 1995.
 Witness: Travis Foster

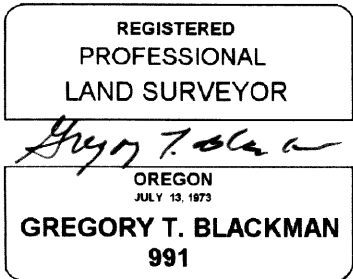

Renewal Date: December, 31 1995

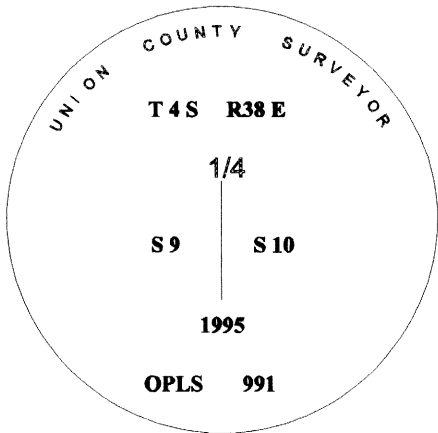

UNION COUNTY SURVEYOR

Date Received 12-26-95

Date Filed 12-29-95

Filed By R. Robinson, Deputy

File Number 046-1995R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 17° East declination, the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 991 to the bearing tree blaze.