
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner originally established by Henry M. Thatcher under GLO contract number 320 dated April 1, 1879. Surveyor General record states:

Set stone 17x9x7 for 4 sec cor from which;

A pine 6 in dia bears N60°W 33 1ks dist A fir 13 in dia bears \$80°E 72 lks dist

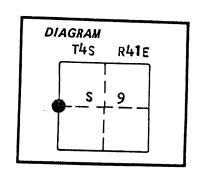

No record of subsequent remonumentation found in county records. Description of corner evidence found:

NONE

UNION COUNTY SURVEYOR
Date Received 10-20-86
Date Filed 10-27-86
BY G. LANGLIE DODIN
File No. <u>204-86 R</u>

See map of survey number 29-86 filed in the office of the Union County Surveyor Description of monument and accessories lestablished to perpetuate the original location of this corner: At proportionate position, I set a 2½1x30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground and raised a small mound


A 12 inch Tamarack bears S 42° E, 53.90 feet, marked $\frac{1}{4}$ S9 BT.

A 13 inch White Fir bears S 23 $^{\circ}$ W, 17.03 feet, marked $\frac{1}{4}$ S8 BT.

Set a steel fence post approximately 5 feet North with a 54-9 sign

Corner set : 8/28/86

Witness: Greg Blackman, Rick Robinson

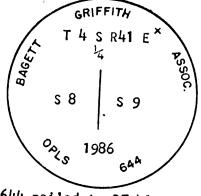

Brass washer marked OPLS 644 nailed to BT blaze. Used steel tape and magnetic compass with 20° East declination. Distances to the BTs are to a 50d spike set in right side of tree when facing tree, unless otherwise stated.

REGISTERED PROFESSIONAL LAND SURVEYOR
Che A Siff
OREGON JULY 10, 1964 DUANE I. GRIFFITH 644

Office of	hu ad
State of	y or
for record on the day of	within instrument was filed in this office
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

☆U.S. GOVERNMENT PRINTING OFFICE-1983-793-276

IZ-11

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Henry M. Thatcher under GLO contract number 320, dated April 1, 1879. Surveyor General record states:

Set stone 17"x9"x7" for 1/4 sec. cor., from which:

A pine 6 ins. in dia. bears N60°W, 33 lks. dist. A fir 13 ins. in dia. bears S80°E, 72 lks. dist.

Corner reestablished by Survey Number 29-86, by proportionate position. No remaining evidence of original corner position found. Union County monumentation records 204-86R states:

Set a 2 1/2"x30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground, and raised a small mound of stone around cap, from which:

A 12 inch Tamarack bears S 42° E, 53.90 feet, marked 1/4 S9 BT. A 13 inch White Fir bears S 23° W, 17.03 feet, marked 1/4 S8 BT.

T4S R41E G-09 S 8

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found 2 $\frac{1}{2}$ " Aluminum pipe with 2 $\frac{1}{2}$ " cap, marked as shown below, 1 inch above ground, in a collar of stone 1 $\frac{1}{2}$ ' in dia., from which:

A stump, species indeterminate, bears South 44° East, a distance of 54.0 feet, no marks visible, but spike in right hand of tree visible.

A White Fir snag, bears South 26° West, a distance of 17.0 feet, high stumped, with healed

A steel fencepost approximately 5 feet North of corner.

See Survey Number 022-2013

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

From the corner monument position,

NEW BEARING TREES

A 20 inch Ponderosa Pine bears North 40° East, a distance of 88.40 feet, marked 1/4 S9 BT.

A 13 inch White Fir bears South 15° East, a distance of 26.45 feet, marked 1/4 S9 BT. A 4 inch Ponderosa Pine bears South 87° West, a distance of 25.80 feet, marked X BT. A 6 inch Ponderosa Pine bears North 54° West, a distance of 16.30 feet, marked 1/4 S8 BT.

I hereby certify that this corner was perpetuated May 6, 2013.


REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON

JEFFREY S. HSU

83571

Renewal Date: June 30, 2015

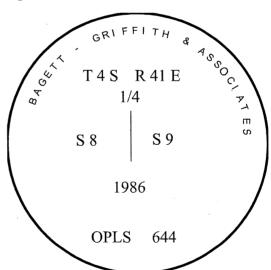

UNION COUNTY

Date Received

Date Filed

File Number

I used a steel tape and magnetic compass in the establishment of the accessories. I used 16° East declination, the distances are to a 60d spike driven into the root crown at the right side of the bearing trees. I place a brass washer marked OPLS 83571 in the lower blaze of the new bearing trees.