CERTIFIED RECORD OF LAND CORNER MONUMENTATION

43

History of original corner establishment:


Original survey by General Land Office contract survey 1882

The original notes state. Set a post from which; A tamarck 30" in diam bears N47°E 66 lks dist marked T5S R35E S34BT A tamarack 20" in diam bears N57°Wi 22 lks dist marked T5S R35E S33BT;

2-13	
DIAGRAM SCOR T5S R35EWM	
s <u>33</u>	S34
T6S	S4 R35½E

Description of corner evidence found:

A stump was found at N47°E 68 lks dist. A tamarack snag bears N57°W 122 lks dist.

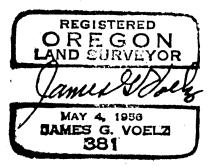

Description of monument and accessories I established to perpetuate the original location of this corner

I set a 2ⁿ galvanized pipe 30ⁿ long with bronze cap on top and ⁱⁿ plate welded to bottom. The pipe set to a death of 25ⁿ.

I stamped the disk.

S COR T5S R35E S33 S34 T6S S4 R35½E ORE LIC 381 1969

The original bearing trees are unsatisfactory.

I set the following new bearing trees; From the monument, 1969

A black pine 8" in diam bears N15°E 19.1 ft. dist marked

T5S R35E S34BT; A 10" black pine bears N58°W 31.9 ft. dist marked

T5S R35E S33BT; A pine 22" in diam bears S8°E 45.2 ft. dist marked T6S R35ES4BT; I set a steel fence post with USFS sign 54-4 attached. USFS National Forest boundary sign was attached to post indicating National Forest land to South.

USFS bearing tree signs were placed on the bearing trees shoulder high facing the corner. Distance measured to center of respective trees and marked with a scribe.

Office of	
for record on the	969. a. 8, o'clock A. B. (signed)
(COUNTY OFFICIAL)	(DEPUTY) Date Received
	Date Filed
	Ву
	File No. 631-84R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

The original survey of the Standard Parallel on the south boundary of T5S, R35E was by J. Cooper, under Contract No. 397, approved April 5, 1882. At this corner he set a post, from which a 30" Tamarack bears N47°E, 68 lks. and a 20" Tamarack bears N57°W, 122 lks.

Index File No. Z-13

DIAGRAM

T5S R35E

SC

S33 S34

Description of corner evidence found: Cap is stamped: S COR Found 3" brass cap on 2" I.D. iron pipe T5S R35E rising 8" above ground. S33 S34 Bearing trees found: T6S S4 An 18" Tamarack, 5.5 ft. tall, bears N57°W, ORE LIC 381 80.5 ft., healed blaze. An 8" L. Pine, 5.5 ft. tall, bears N57°W, 31.9 ft., 1984 blazed & scribed.

A 7" L. Pine, dead, bears N15°E, 19.1 ft., blazed and scribed. A 29" Tamarack stump bears N47°E, 45.0 ft., log lying face down on blaze beside stump.

Corner by LS 381 is recorded on document #631-84R with the Union County Surveyor.

Description of monument and accessories I established to perpetuate the original location of this corner:

New BT's:

An 8" Fir bears N 8 1/4°W, 142.6 ft., blazed & scribed: SC T5S R35E S33BT. A 7" Fir bears N81°E, 15.7 ft., blazed and scribed: SC T5S R35E S34 BT.


Brass LS 1844 disc in lower end of blazes. Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982.

Compass Declination: 19 3/4°E

Witness: Duane Scott

Corner is found140 ft. north of Road 5160-014, 650 ft. east of intersection with Road 5160-050.

I hereby certify the above described corner monument and/or accessories was established as described on August 7, 1984.

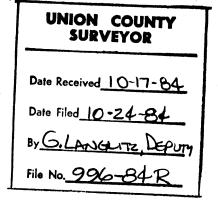

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
DAVID E. SCOTT
1844

Office of	County of
	certify that the within instrument was filed in this office
for record on the day of	
	by
(COUNTY OFFICIAL)	(DEPUTY)