INDEX NO. L-19

History of original corner establishment:

None. Corner established this survey.

Description of Corner Evidence Found:

None. Corner established this survey.

Description of monument and accessories I established to perpetuate the original location of this corner:

| S-17-96 | Part | Pa

Set 2" O.D. x 30" galanized iron pipe with 2" aluminum cap, with magnet and flared ends, stamped as shown on the DIAGRAM, extending 0.9 ft. above the ground, in a mound of stone, with a 3 ft. base

From Which:

Ponderosa Pine, 8" dia., bears S51°44'W, 51.2 ft., scribed: C 1/4 S14 BT Ponderosa Pine, 11" dia., bears S31°47'E, 45.2 ft., scribed: C 1/4 S14 BT Ponderosa Pine, 18" dia., bears N75°34'E, 32.8 ft., scribed: C 1/4 S14 BT Ponderosa Pine, 18" dia., bears N26°37'W, 18.3 ft., scribed: C 1/4 S14 BT


Measurements to BT's taken with total station and chain with bearings based on the survey control network; bearings taken to an 8" spike set at top of blaze, extending out 2"+/-. Nailed Bearing Tree (54-3) signs above blaze and Land Survey Monument (54-9) signs on back of each tree as required. Painted a 6" red band above Bearing Trees signs. Set 1/2" brass disc at base of blaze stamped: "L. MILLER PLS 2513". Spike and nail in brass disc on vertical line. Set steel fence post with Land Survey Monument (54-9) and Property Boundary (54-2) signs alongside monument. Set steel fence post with 54-2 sign 50' West and 50' South from the monument.

\$ 501 KES REMOVED 8-27-96 REAL MF #963772

II" PP

This monumentation was performed by: Linda Lee Miller, PLS 2513 Witnessed by: Russell Avery, PE, PLS August 22, 1994

Sketch USFS 18'PP 18"PP 18"PP

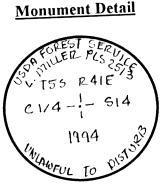

Location/Comments

Mean Magnetic
Declination 20° East

