#### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Not set.

Index File No. J-2

DIAGRAM

T6SR38E

S7

W-1/16

S18

T6SR38E

Date Filed

File No. 788-84 R

#### Description of corner evidence found:

None.

Corner falls above main road on flat bench. Corner was about 15' East of steel fence post and BLM tag marking approximate corner location. Pulled steel fence post.

## Description of monument and accessories I established to perpetuate the original location of this corner:

At surveyed point set 2 1/2" x 30" galvanized pipe and brass cap marked:

Set pipe 24" in the ground and small mound of stone around to cap.

From which, by magnetic declination of N20°E:

A 9" tamarac bears N40°E, 58.8 ft. scribed

W 1/16 S7 BT. A 12" pine bears S54°W, 59.7 ft. scribed W 1/16 S18 BT. Placed 54-3s and brass washers stamped PLS 1051 on BTs. Painted blazes red and 6" red band around. Placed 54-2, 54-4, and 54-9 on steel fence post 5' South of corner.

PROFESSIONAL
LAND SURVEYOR

OREGON
OCT. 17. 1975
BARRY B. BARBOUR
1 0 5 1

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Cecil O. Prophet
Doris Grey

October 4, 1979

Office of County Surveyor county of Union State of Oregon I hereby certify that the within instrument was fi	
for record on the S.th. day of December	
Form R6-7100-57 (9/71)	Date Received PO-798.275

#### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was set October 4, 1979 under U.S.F.S. Contract

Hanley Engineering had information that placed the section corner for sections 7, 8, 17 and 18 to a new position. I agreed to this position and they monumented the corner in March, 1981. The new position moved this corner and it was reset April 8, 1981.

DIAGRAM

T6SR38E

S7

W—1-1/16

S18

Index File No. J-2

#### Description of corner evidence found:

Corner falls above main road on flat bench. Corner was about 15' east of steel fence post and BLM tag marking approximate corner location. Pulled steel fence post.

# Description of monument and accessories I established to perpetuate the original location of this corner:

At new surveyed point set 2 1/2" X 30" galvanized pipe and brass cap that was set in 1979. Cap marked:
Set pipe 24" in the ground and mound of stone around to cap.
From which by magnetic declination of N20°E:
A 9" Tamarac bears N50°E 75.2 ft. scribed W 1/16 S7 BT.
A 14" Pine bears S43°W, 43.5 ft. scribed W 1/16 S18 BT.
These are the 1979 BTs.
Placed 54-3s and 54-9s and brass washer stamped PLS 1051 on BTs.

Placed 54-2 and 54-9 on steel fence post 5' south of the corner

RESET 1981 T6SR38E S7 W — 1/16 S18 OR PLS 1051 1979

File Na 787-84 R

REGISTERED PROFESSIONAL

LAND SURVEYOR

Barry B Barrour OREGON OCT. 17, 1978 BARRY B. BARROUR 1 0 5 1 I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Daniel Rowland Douglas Moser

April 8, 1981

Office of County Surveyor County of Union	
State of. Oregon , I hereby certify that the within instrument was filed in th	is office
HOWARD L. HERRY by John J. County Official)	UNION COMPATY SURVEYOR
Form R6-7100-57 (9/71)	Date Received
	Date Filed

#### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

#### History of original corner establishment:

Corner set by Barry B. Barbour, LS 1051, as described by File No. 787-84R, filed June 26, 1981, in the records of the Union County Surveyor.

Record states: Hanley Engineering had information that placed the section corner for sections 7, 8, 17 and 18 in a new position. Mr. Barbour agreed to this position and Hanley Engineering monumented the section corner in March, 1981. The new position moved this corner and it was reset April 8 1981.


Corner falls above main road on flat bench.

At new surveyed point set 2½" x 30" galvanized pipe and brass cap that was set in 1979. Cap marked (as shown below): Set pipe 24" in the ground and mound of stone around to cap. From which, by magnetic declination of N20°E:

A 9" Tamarac [sic] bears N50°E, 75.2 ft. scribed W1/16 S7 BT.

A 14" Pine bears S43°W, 43.5 ft. scribed W1/16 S18 BT.

These are the 1979 BTs.

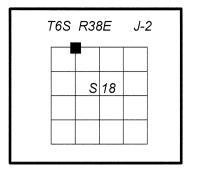


#### Description of corner evidence found:

Found  $2\frac{1}{2}$  ins. diam. iron pipe, projecting 6 ins. above ground, with rock collar, and  $2\frac{1}{2}$  ins. diam. brass cap, marked as shown:

From the recovered monument I find the Barbour bearing trees:

A 6 ft high cut tamarack stump, 11 ins. diam., bears N. 50° E., 75.2 ft. dist., with healed double blaze. A ponderosa pine, 17 ins. diam., bears S. 43° W., 43.5 ft. dist., alive and healthy, with full scribe visible on open double blaze and brass washer in lower blaze.

Found guard post ±5 ft S'ly, added Land Survey Monument (54-9) sign.

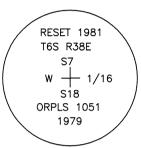

## Description of monument and accessories I established to perpetuate original location of this corner:

New bearing tree:

A tamarack, 15 ins. diam., bears N. 11½° W, 8.9 ft. dist., mkd. W1/16 S7 BT.

New bearing tree marked on a single blaze and has a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position:

Lat. 45°02'58.1" N

Long. 118°06'38.6" W

I hereby certify that the corner is monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on October 11, 2014.

Witnesses: Brenda Johnson

REGISTERED PROFESSIONAL LAND SURVEYOR

### Deceased

OREGON JANUARY 18, 1994 RON C. WALTER 2648

Renewal Date: June 30, 2016

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON July 22, 1977 WILLIAM R. WELLS 1106

Renewal Date: June 30, 2016

# UNION COUNTY SURVEYOR Date Received 2 25 15 Date Filed 2 25 15 By JUGAN File No. 062-7015 R

**NOTE:** See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey , CS 010-2015, filed concurrently with this Land Corner Record.