CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by William H. Odell and Joseph G. Gray under glo joint contract number 120, dated May 27, 1867 Surveyor General record states:

Set post cor for Secs 7,12,13 & 18 from which:

- A pine 8 in dia bears N430E 10 1ks
- A pine 7 in dia bears \$37°E 10 1ks
- A pine 12 in dia bears \$450 W 47 1ks
- A fir 24 in dia bears N400W 42 1ks

DIAGRA	4M 111
•	.741E
S 12	s 7
s 13	s 18

Description of corner evidence found:

Found a 28 inch diameter P.Pine N56°E 6.6 feet, live and vigorous, scribes visible Found 27 inch diameter P.Pine S41°E 6.6 feet, live and vigorous, no scribes visible Found 24 inch diameter P.Pine S36°W \pm 30 ft. m/1 dead and down, scribes visible

Found mound of stone at record distances from the two standing BTs

Distances to standing BTs are to face of blaze

Description of monument and accessories I established to perpetuate the

original location of this corner: At record distance from the two standing BTs and in the mound of stone, I set a $2\frac{1}{2}$ inch x 30 inch aluminum pipe with aluminum cap marked as shown, 26 inches in the ground from which,

New 3Ts

A 16 inch diameter red fir bears $$16^{\circ}\text{W}$, 41.0 feet marked T1N R40E S13 BT A 17 inch diameter red fir bears $$N65^{\circ}\text{W}$$ 73.0 feet marked T1N R40E S12 BT

Raised mound of stone around monument

Corner set May 8, 1984


TENEROS CORRESTO

Witnesses: Duane Griffith and Rick Robinson

SURVEYOR
Date Received 5-29-84
Date Filed <u>5-31-84</u>
By G. LANGLITZ DEPUM
File No. 860-84-R

See survey number 21-84



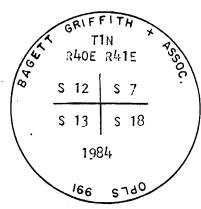

I used a steel tape and magnetic compass in the establishment of accessories. I used 18° East magnetic declination, and distances to the new BTs are to the center of the tree. I placed a brass washer marked OPLS 991 by the BT blaze of new BTs.

Office of	County of
	tify that the within instrument was filed in this office
for record on the day of	
	by
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

☆ GPO---798-276