CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Timothy W. Davenport under GLO contract Number 102, dated July 20, 1863. Surveyor General record states:

Set post from which:

A Tamarack 16" dia. bears N35°W, 40 lks. A Tamarack 30" dia. bears S5040°E, 55 lks.

No record of subsequent monumentation found in Union County survey records. DESCRIPTION OF CORNER EVIDENCE FOUND: None

See Union County Survey 025-1996

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

The proportioned position of the corner is in Indian Creek, I set a 20" aluminum pipe with $2\frac{1}{2}$ " aluminum cap as a reference monument. The I set a 2½" x reference monument is marked as shown below and set 30" in the ground, with a ring of stone.

REFERENCES TO TRUE CORNER POSITION:

The reference monument described above bears S 89°42'31" E, 50.00 feet.

A 15" White Fir bears N56°E, 35.17 feet, marked 1/4 S18 BT. A 18" White Fir bears S57°E, 31.29 feet, marked X BT. A 22" White Fir bears S12°W, 54.13 feet, marked 1/4 S13 BT. A 20" White Fir bears N63°W, 53.92 feet, marked XX BT.


I hereby certify that the corner was monumented on July 19, 1996. Witness: Mark Durbin, Travis Foster

> REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON

JEFFERY P. PETERSEN 2625

Renewal Date: December, 31 1996

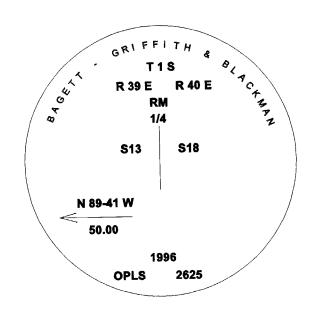

T1S R40E L-01

18

UNION COUNTY **SURVEYOR**

Date Received 7-30-96

Date Filed 7-31-96

File Number <u>085</u>–1996 R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 2625 is attached to the BT blaze.