
## IFIED RECORD OF LAND CORNER MONUMENT

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Originally established by David P. Thompson under GLO Contract No. 103, dated September 3, 1863. Surveyor record states:

Set post for 1/4 Sec Corner in mound of Earth with pits, trench, charred stake as per instructions.

Survey 73-78 finds no evidence of corner and uses a proportioned position. This position is used in Surveys 1-90, 017-2000, 004-2007, and Minor Partitions 20080024T, 20110014T and 20120001T.

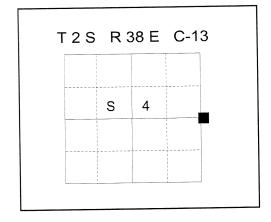

## DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

See Minor Partition 20120003T

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

## TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position determined by survey, I set a 2 1/2" diameter x 30" aluminum pipe with 2 ½" aluminum cap marked as shown below, 24 inches in the ground, in a mound of stone, 2 feet in diameter, from which:

NEW ACCESSORIES:

A 5/8"x30" iron pin with 1 ½" aluminum cap marked "BGB SURVEY MARKER NE RP" bears

South 84°15'21" East, a distance of 16.99 ft.

A 5/8"x30" iron pin with 1 ½" aluminum cap marked "BGB SURVEY MARKER SE RP" bears South 39°18'56" East, a distance of 19.67 ft.

A 5/8"x30" iron pin with 1 ½" aluminum cap marked "BGB SURVEY MARKER SW RP" bears 1.0841130" West 2 distance of 18.93 ft. in a North/South running fence South 16°41'20" West, a distance of 18.93 ft. in a North/South running fence.

A 5/8"x30" iron pin with 1 ½" aluminum cap marked "BGB SURVEY MARKER NW RP" bears

North 53°07'21" West, a distance of 9.50 ft. in a North/South running fence.

Corner falls 7 feet East of a North/South running fenceline, approximately 47 feet North and 6 feet East of an existing fence corner. Corner lies in a brushy willow patch with a creek running to the Northeast. Accessory marked as 'NE' placed in the SE quadrant to ensure durability as the creek occupies the Northeast quadrant.

I hereby certify that the corner was monumented on January 27, 2012

Witness: Rick G. Robinson

REGISTERED **PROFESSIONAL** AND SURVEYOR

OREGON June 2, 2010 JEFFERY S. HSU 83571

Renewal Date: June 30, 2013

BA GAY T2S **R38E** 1/4 2012 **OPLS 83571** 

UNION COUNTY **SURVEYOR** Date Received 213 2/3/17

File Number 007-2017

I used a Leica system 1200 GPS unit in the establishment of these accessories. The basis of bearing is that of Minor Partition 20120003T, Plat records of Union County. The distances are to the center of the caps.