
CORNER REFERENCE INDEX

EXA	MPLE	
REFERENCE NO.		EXPLANATION
10 - 83	Refer	to Survey Map File
10 - 83N	Refer	to Narrative File
IO-83R Refer		to Corner Restoration File
1116 110.		

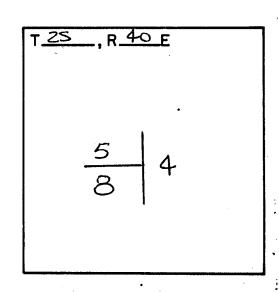

REFERENCE NO.	NOTES & DESCRIPTION	
103-85 R	SET ALUNINUM NON. FROM EVIDENCE	LANGLITZ-1985
SURVEY 35-88	FO. MONUMENT SET BY LS 1099	HANLEY-1988
GPS#200332	GPS DATA SAGET	ROBINSON- 2003
3,3,3,3,3	O, o on / g on e	1-013/10/201
		*
	·	

CORNER LOCATION CODE 6 - 9

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original General Land Office survey states: Set post 4 ft. long, 4 in. square, 24 in. in ground, for Cor. to Sec. 5 and 8 marked T2S R40E on W., S5 on N., S8 on S. face, with


5 notches on S. and 4 notches on E face, from which An Alder, 5 in. diam., bears N32°E 20 lks. dist., marked R40E BT,

An Alder, 6 in. diam., bears N67°W 34 lks. dist., marked T2S S5 BT

A Fir, 9 in. diam., bears S71°E 30 lks. dist., marked T2S BT,

A Fir 15 in. diam. bears S37°W 104 lks. dist., marked R40E S8 BT

Little Indian Creek, 5 links North, runs NW

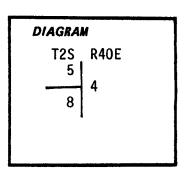

Description of corner evidence found:

Found the remains of the original SE bearing tree, a 24" Douglas Fir stump, badly decayed, with scribing "4" visible on previously opened upper blaze and detached wood lying nearby, and scribing "BT" visible on previously opened lower blaze.

No evidence of the remaining original BT's or corner post was found.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the original corner point determined at record bearing and distance from the original SE bearing tree, we set a 2"x30" aluminum pipe, 24" in the ground and supported in a mound of stone, with aluminum cap, marked:

From Which:

The original SE bearing tree, previously described, bears S71°E 19.8 feet to the blazed face. We mark new BT's as follows:

A 10" Englemann Spruce, scribed "T2S R40E S5 BT" on a double

blaze, bears N11°W 67.7 ft.

And a 14" Englemann Spruce, scribed "T2S R40E S8 BT" on a double blaze, bears S18°W 9.2 ft.

Attached brass washer, marked "LS 1099" to lower blaze of new BT's.

Magnetic Compass (20° East Declination).

Steel Tape

Corner is located approx. 10 ft. south of Little Indian Creek, course West and 12 Feet West of a N-S fence along the West edge of a clearcut strip.

for record on the...... day of....... , 19.....

October 15, 1985

Gary Langlitz, LS 1099 Raymond McVey, Forester Boise Cascade

 S4 1099 985
REGISTERED PROFESSIONAL LAND SURVEYOR

R40E

T2S

S5

CARY L. LANGLITZ

MOINL	COUNTY
SUR\	/EYOR

Date Filed 11-18-85

File No. 103-85 R

...... by (COUNTY OFFICIAL)

Office of...... County of..... State of....... , I hereby certify that the within instrument was filed in this office

HORIZONTAL CONTROL DATA

UNION COUNTY, OREGON OREGON STATE PLANE, NORTH ZONE (3601)

STA NAME:

200332

SECTION CORNER COMMON TO SECTIONS: 5 & 8 ONLY

TWP.

Company

2

S.

RGE. 40

E.

GEODETIC COORD: NAD 83(91)

DATE TIED: November 2003

LAT:

45 ° 24 '

47.57878 " N

SURVEYOR: RICK G. ROBINSON

OPLS 2219

LONG:

117° 49'

46.49645 " W

FIRM: BAGETT, GRIFFITH, & BLACKMAN

2006 ADAMS AVENUE

LAGRANDE, OR 97850

(541) 963-6092

N:

648077.561

SP. COOR: NAD 83(91)

INT FT.

E:

8887719.405

INT FT.

TYPE: GPS

THETA:

1 ° 53 ' 37.7622903 "

ORDER: SECOND CLASS: 1

SCALE FACTOR:

0.9999036688

ELEV:

4006.29

US FT.

ELEV: DATUM: NGVD 29

COMMENTS:

Corner is 2 1/2" brass cap monument

10 ft. +/- South of Little Indian Creek

T2S R40E S 5 S 4 PLS 1099 1985

REGISTERED **PROFESSIONAL**

RICK G. ROBINSON 2219

Renewal Date December 31, 2004

1 METER = 3.2808333333... US FEET = 39.37 INCHES

1 METER = 3.280839895 INT'L FEET OR 1 INCH = 2.54 CM

TO CALCULATE ELEVATION FACTOR (IN THE NORTH AMERICAN CONTINENT)

DIVIDE 20,906,000 BY (20,906,000 + ELLIPSOID ELEV. IN FEET)