
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## History of original corner establishment:

Corner established by Henry Meldrum under GLO Contract no. 450 dated June 11, 1882, and his record states:

A post 3 ft long 3 ins square 24 ins in ground for 1/4 Sec. Cor. marked 1/4S on W face, from which:

A tamarack 6 ins diam bears E, 25 lks dist marked 1/4 S. B. T. A tamarack 7 ins diam bears S40 W, 15 lks dist marked 1/4 S.B.T

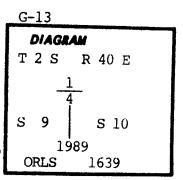

## Description of corner evidence found:

None. Corner reestablished by proportionate measurement from survey control.

Corner not found on north slope predominantly forested with white fir and western larch and with several deterioriated tree remains. Only a few trees over 75 years old indicating old burn area.

## Description of monument and accessories I established to perpetuate the original location of this corner:

At position midway between adjacent section corners north and south...

Set a 2" x 30" aluminum pipe with  $2\frac{1}{2}$ " aluminum cap 24" in ground & projecting 6" out of ground with surrounding earth mound & placed 6' steel fence post alongside with sign: 54-9 attached. Cap marked as shown in corner diagram. No stones available for mound.

New bearing trees established: Western larch 8" dia brs S45½°E, 15.7' dist mkd 1/4 S10 BT. Spruce 10" dia brs S75°W, 22.1' dist mkd 1/4 S9 BT.

New bearing trees have a brass washer marked PLS 1639 nailed flush to face of blaze. Attached signs 54-3 & 54-9 & painted face of blaze & a 6' band of red around each bearing tree.

Compass declination 190 East.

I hereby certify that the above described corner monument was properly established by me & witnessed by F.S. Munro on October 01, 1989.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Harley
OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of County Surveyor County of Union State of Oregon I hereby certify that the within instrument was filed in this office.	
for record on the day of	
(COUNTY OFFICIAL)	SURVEYOR
Form R6-7100-57 (9/71)	Ento Picceived 3-12-90
	Deta Bled 3-12-90

\*GPO-591-971, 1988

G-13