UNION COUNTY SURVEYOR

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Jacob C. Cooper, under GLO Contract No. 397, Dated July 1, 1881. Surveyor General record states:

I marked a 6" fir for the corner to Secs. 1, 6, 7 and 12

T4S S6 on Northeast, R37E S7 on SE, R36E S12 on SW and S1 on the Northwest faces with5 notches on the South and 1 noth on the NE edge. From Which: A Fir 12" diameter bears S73°E 6 lks distant,

marked T4S R37E, S7 BT. A Fir 8" diameter bears S23°W, 16 lks. distant,

marked T4S R36E, S12 BT. A double Fir 10" diameter bears N 70°W 20 lks distant, marked T4S R36E, S1 BT.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found the original Fir corner tree, now a rotted stump. Found the SW Bearing tree dead and down, rotting, scribes visible. Found the Southeast and Northwest BT's, now stumps, no scribing.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position occupied by the original corner tree, I set a 2½x30" aluminum pipe with aluminum cap marked as shown below, 20" in the ground and raised a small mound of stone with a 2ft. base to top of cap. From Which:

A 10" Ponderosa Pine bears N57°E, a distance of 38.95 feet, marked T4S R37E S6 BT

A 13" Ponderosa Pine bears S80°E, a distance of 60.51 feet, marked T4S R37E S7 BT

A 20" Ponderosa Pine bears S50°W, a distance of 16.84 feet, marked T4S R36E S12 BT

A 12" Ponderosa Pine bears N38°W, a distance of 62.58 feet, marked T4S R36E S1 BT


I hereby certify that the corner was monumented on August 11, 2004 Witness: Mike Spicer

REGISTERED **PROFESSIONAL**

Renewal Date: December 31, 2005

LAND SURVEYOR **ÓREGON GREGORY T. BLACKMAN** 991

UNION COUNTY **SURVEYOR** Date Received 12/1/04

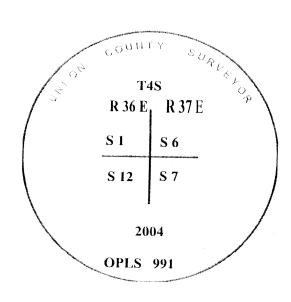

745 R36E E-81

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination. The distances to the bearing trees are to a 50d spike driven on the right side of the tree at the root crown. I attached a brass washer marked OPLS 991 to the BT blaze.