


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

A-21
~~Z-21~~

History of original corner establishment:

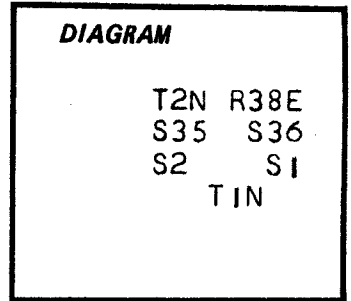

4'x4' SQ. IN. WOODEN POST 24" IN THE GROUND

14" FIR N82E 57Lks. MKD. T2N R38E S36 BT
11" FIR S61E 24Lks. MKD. TIN R38E S1 BT
14" FIR S06W 44Lks. MKD. TIN R38E S2 BT

Description of corner evidence found:

MOUND OF STONES


24" FIR N82E 37.6' SCRIBES VISIBLE ON SNAG
20" FIR S61E 15.8' BLOW-DOWN, SCRIBING VISIBLE
ROTTING STUMP S20W 29.0'

Description of monument and accessories established to perpetuate the original location of this corner:

SET 2"x30" IRON PIPE WITH BRASS-CAP MARKED: T2N R38E
S35 S36
S2 S1
TIN
1978
RLS 346

14" FIR S80W 18.3' MKD. TIN R38E S2 BT
12" FIR N21E 14.7' MKD. T2N R38E S36 BT
6" FIR S17E 29.7' MKD. TIN R38E S2 BT

ALL BT'S HAVE A RED PAINTED STRIPE AND BT SIGNS. THE NEW BT'S HAVE A BRASS-WASHER STAMPED RLS 346 NAILED TO THE LOWER FACE. A 6' STEEL FENCE POST IS WITHIN 5' OF THE CORNER.

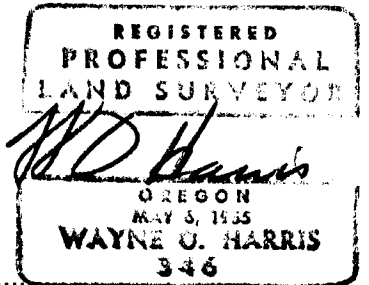

Office of.....COUNTY SURVEYOR..... County of.....UNION.....
State of.....OREGON....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

UNION COUNTY SURVEYOR	
Date Received	_____
Date Filed	_____
By	_____
File No.	15-84 R