



Land Surveying &
Boundary Consulting

P.O. Box 19.
Mill City, OR 97360
(503) 897-2722

**CERTIFIED RECORD OF LAND
CORNER MONUMENTATION**

History of original corner establishment:


Gary Langlitz, PLS 1099, 1980, CS97-80

Set: by single proportionate measurement, a 2" x 30" galvanized iron pipe, 28" in the ground, with brass cap, from which:

An 8" white fir, scribed "W 1/16 S6 BT" on a double blaze bears N 70 1/2° E 62.8 feet.

An 8" larch, scribed "W 1/16 S7 BT" on a double blaze, bears S 42° E 69.8 feet.

Attached brass washer marked "LS1099" to lower blaze of each BT.

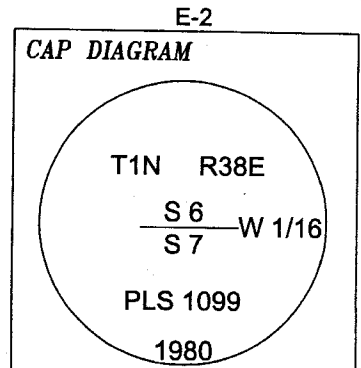

Description of corner evidence found:

Monument Found:

A 2 1/2" brasscap, marked as shown, on a 2 1/2" (not 2") galvanized iron pipe, 3" showing above the ground. Guard post northeast 5 ft.

Accessories Found:

A white fir, 14 ins. diam., alive & healthy, bears N 70 1/2° E 62.8 ft. with a double blaze and brass washer.

A tamarack, dead & standing, 14 ins. diam., bears S 42° E 71.6 ft. (record 69.8 ft.) marked W 1/16 S7 BT on a double blaze with brass washer.

Description of monument and accessories I established to perpetuate the original location of this corner:

Accessories Set:

A tamarack, 17 ins., diam., bears S 55° E 40.2 ft. marked W 1/16 S7 BT on a double blaze with a brass washer stamped PLS 2456.

Red paint, posts, and signs added as needed.

Equipment: Hand compass, Var. 18° E, Nikon total station, nylon tape, clinometer.

Date: July 17, 2003

Crew: Ron Walter, Collin Edwards-Hill

NAD 83 (CORS 2002) Coordinates:

Geographic	State Plane
45°35'14.1004" N	N 216,171.895Meters
118°06'47.0694" W	E 2,686,227.328 Meters

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Evelyn R. Kalb 9/13/03

OREGON
July 25, 1990
Evelyn R. Kalb
2456

EXPIRES: 06/30/2005

See also the Record of Survey filed concurrently with this certification.

**UNION COUNTY
SURVEYOR**

Date Received 10/21/03

Date Filed 10/31/03

Filed By [Signature]


File Number 041-2003R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. E-2

History of original corner establishment:

None

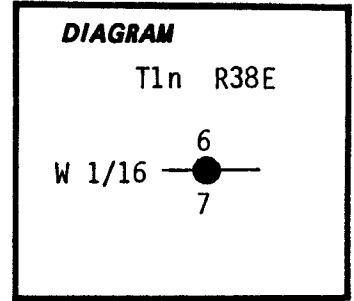

Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner:

Corner set from survey by single proportionate measurement.

At the corner point, we set a 2"x30" Galvanized Iron Pipe, 28" in the ground, with brass cap attached, marked:

T1N R38E

From which we mark new BT's:

S6 1
 —+— W 16
 S7
 PLS 1099
 1980

An 8" Larch, scribed "W 1/16 S7 BT" on a double blaze, bears S42°E 69.8 ft.

An 8" White Fir, scribed "W 1/16 S6 BT" on a double blaze bears N70 1/2°E 62.8 ft.

Attached brass washer marked "LS1099" to lower blaze of each BT.

Placed steel fenceposts approx. 5 ft. N and E of monument with signs 54-2 and 54-9 attached.

Attached signs and painted BT's per Standard Specifications for Cadastral Survey U.S.F.S. Region 6, Oct. 1979.

I hereby certify this corner monument was established as herein described on Dec. 2, 1980.

Compass Declination: 20° East

Witness: David Allen

Office of..... County Surveyor..... County of..... Union.....

State of..... Oregon..... I hereby certify that the within instrument was filed in this office

for record on the..... day of....., 19.....

..... by

(COUNTY OFFICIAL)

REGISTERED PROFESSIONAL LAND SURVEYOR

Gary L. Langlitz
OREGON
JULY 28, 1977
GARY L. LANGLITZ
1099

UNION COUNTY SURVEYOR
 Received _____
 Date Filed _____
 By _____
 File No. 32-84 R

☆ GPO—798-278