


E-21

RECOVERY NOTES
BOISE CASCADE CORP.
PROPERTY CORNER INVESTIGATION

USFS Quail Creek

LOCATION

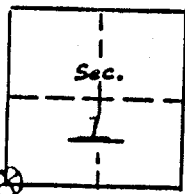

T. 1N R. 33E

Mer. WM State OR

Forest _____ Dist. E 1/4 2x

Compartment or Tract G. Phillips

LEGEND

- Corner searched-no evidence
- ⊗ Corner or accessory found
- Corner marked by perm. mon.

DESCRIPTION OF FOUND CORNER

MATERIAL: Rock SIZE: 15x8x3

HEIGHT ABOVE GROUND: 12" CONDITION: OK

MARKINGS: 5 notches on S, 1 notch on E
stones piled around rock.

DESCRIPTION OF FOUND ACCESSORIES

Found pile of stones with corner stone
in center - old rotted stake lying down.
Re-piled stones around corner rock & reset
stake. Painted same. Installed location tag
on gate post 6 ch E of corner, near a road.

Note: Indicate full investigative details on back of form and where
cruise tag placed in reference to corner.

PHOTO IDENTIFICATION

Symbol & date B-18-73 Line or Roll _____ Exposure 10-7

How Identified _____ Where filed _____

RECOVERED BY: RLM

DATE: 7-27-77 TITLE: FOREST

UNION COUNTY
SURVEYOR

Date Received 1-4-88

Date Filed 1-7-88

By G. LANGLITZ, DEPUTY

File No. 25-88R

E-21

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


E-21

History of original corner establishment:

Gray and Odell under G.L.O. Contract No. 120, dated May 27, 1867, set a post, deposited a marked stone and raised a mound of stone.

John W. Kimbrell under G.L.O. Contract No. 579, dated June 6, 1891, found a marked post 4' long and 4" square lying on the side of a mound of stone. He reset the post in the mound of stone.

In 1977, Ray McVey, Boise-Cascade Co., found a rock 15"x 8"x 3" marked with 5 notches on S. face and 1 notch on E. face. He reset rock, rebuilt mound and painted rocks red and yellow.

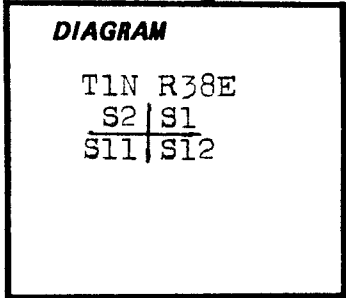

Description of corner evidence found:

I found a stone 16"x 9"x 3" in a mound of stone. Stone is painted yellow and is only one of size reported by McVey. I could not discern the notches.

Description of monument and accessories established to perpetuate the original location of this corner:

In place of the stone I set a 2 1/2"x 30" alum. pipe with a 2 1/2" alum. cap marked:

Monument is 14" in ground and surrounded by a mound of stone. Original stone is buried alongside. From the corner:

- A Ponderosa Pine, 11" dia., S55°W, 159.4 ft.; marked: T1N R38E S11 BT
- A Ponderosa Pine, 7" dia., S68°E, 176.8 ft.; marked: T1N R38E S12 BT
- A 5/8"x 30" iron pin (rebar) driven 23" in ground with 2" dia. alum. cap marked: PLS 1832, N41 1/2°E, 63.4 ft.
- A 5/8"x 30" iron pin (rebar) driven 20" in ground with a 1 1/4" dia. yellow plastic cap marked: PLS 1832, N61 3/4°W, 95.4 ft.

T1N R38E
S2 | S1
S11 | S12
PLS 1832
1991

BTs have blaze and a 6" band painted red, BT tags, "Land Survey Monument" signs and alum. "PLS 1832" washers nailed to the bottom of the blaze. There is a 6' steel fence post with a "Land Survey Monument" sign within 5' of the corner.

Measured to center of BTs using steel tape and staff compass. Magnetic declination set at 19°E.

Oct. 4, 1991

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Fayette S. Munro

OREGON
JULY 13, 1979
FAYETTE S. MUNRO
1832

Office of..... County of.....
State of..... I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by

**UNION COUNTY
SURVEYOR**

(DEPUTY)

Date Received 12/9/91

Date Filed 12/12/91

By Guy Black

File No. 037-1991R