


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-11

History of original corner establishment:

Original survey being by contract Aug 29, 1891
The original notes state, Set post from which;
A pine 24" in diam bears S76°E 231 lks marked $\frac{1}{4}$ SBT;
A pine 12" in diam bears N5°W 160 lks marked $\frac{1}{4}$ SBT;

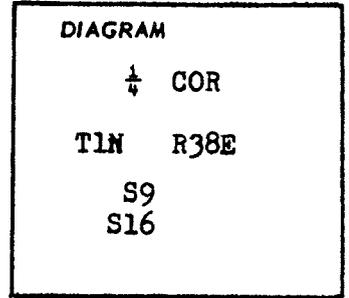

Description of corner evidence found:

A pine log was found on the ground at S76°E with a scribe;
At N5°W at 160 lks a pine is standing but no scribe is visible.;
A mound of stone was found at the corner.

UNION COUNTY SURVEYOR

Date Received _____

Date Filed _____

By _____


File No. 63-84R

Description of monument and accessories established to perpetuate the original location of this corner

At the position of the corner I set a 2" pipe 30" long with a brass cap on top at a depth of approx 1' and raised stone mound around the pipe.
From the corner I set the following new bearing trees.;

A Pine 12" in diam bears N60°E 69.0 ft.; marked $\frac{1}{4}$ SBT;
A pine 18" in diam bears S44°W 88 ft. marked $\frac{1}{4}$ SBT'
USFS bearing tree signs were placed on the bearing trees new and old.
All measurements were taken to BT scribe along surface of the ground.

I stamped the disk

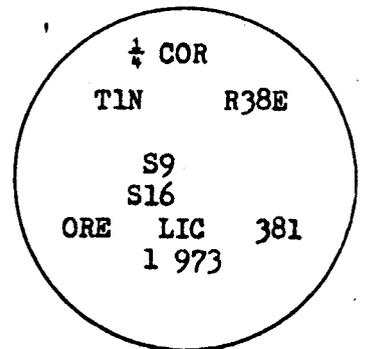

Office of S County surveyor County of Union
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 3 day of Oct, 1973, at 5 o'clock P (signed)
_____ by _____
(COUNTY OFFICIAL) (DEPUTY)

REGISTERED
PROFESSIONAL
LAND SURVEYOR

J. G. Voelz
OREGON
MAY 4, 1956
JAMES G. VOELZ
381