


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

None.

T 1 N R 38 E L-23

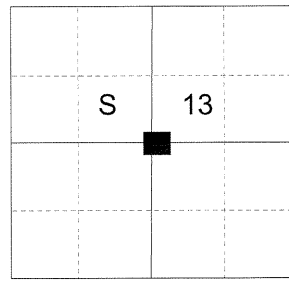

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

SEE SURVEY NUMBER 008-2019

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At the position by survey I set a 2 1/2" x 30" aluminum pipe, 15" in the ground, in a mound of stone 3' with 3" aluminum cap marked as shown below, from which:

NEW BEARING TREES:

- A 5/8"x18" iron pin bears North 45° East a dist. of 40.00 ft., with 1 1/2" aluminum cap marked NE RP.
- A 5/8"x30" iron pin bears South 45° East a dist. of 31.00 ft., with 1 1/2" aluminum cap marked SE RP.
- A 5/8"x30" iron pin bears South 45° West a dist. of 45.00 ft., with 1 1/2" aluminum cap marked SW RP.
- A 5/8"x30" iron pin bears North 45° West a dist. of 10.00 ft., with 1 1/2" aluminum cap marked NW RP.

Set steel fence post approx. 1' West.

West/South fence corner bears North West of monument approx. 180 ft..

I hereby certify that the corner was monumented on May 9, 2019.

Witness: Kyle A. Tucker.

REGISTERED
PROFESSIONAL
LAND SURVEYOR



OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2019

BAGETT - GRIFFITH & BLACKMAN

T1N R38E

C 1/4 S13

2019

OPLS 83571

UNION COUNTY
SURVEYOR

Date Received 5/14/19

Date Filed 5/14/19

Filed By N. L. Gilman

File Number 027-2019R

I used a Leica GS18 RTK GPS in the establishment of the new accessories. Basis of Bearing is as per survey 008-2019. Bearings and distances are to the center of the aluminum cap.