CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by John W. Kimbrell under GLO Contract Number 579, dated June 22, 1891. Surveyor General field notes state:

Set post 3 ft. long, 3 ins. square, 24 ins. in the ground for 1/4 Sec. Cor. marked 1/4 S on N face, from which:

A fir, 3 ins. dia., brs. N 12° E, 20 lks. dist., marked 1/4 S

A Tamarack, 3 ins. dia., brs. S 15° W, 13 lks. dist., marked 1/4 S BT.

S 20	T 1 N	R	38 E	N-C
		S	20	

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

SEE SURVEY NUMBER 018-2014

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate distance, I set a 2 ½"x30" aluminum pipe with 2 ½" aluminum cap, marked as shown below, 28 inches in the ground, from which:

A 16 inch Western Larch bears North 39° East, a distance of 9.60 feet, marked 1/4 S17 BT.

A 17 inch White Fir bears South 37° East, a distance of 14.95 feet, marked 1/4 S20 BT. A 16 inch White Fir bears South 81° West, a distance of 28.90 feet, marked 1/4 S20 BT. A 6 inch White Fir bears North 57° West, a distance of 19.75 feet, marked 1/4 S17 BT.

I set a steel fencepost approximately 1 foot North of corner monument.


I hereby certify that the corner was monumented on June 28, 2014.

REGISTERED **PROFESSIONAL** LAND SURVEYOR OREGON JEFFREY S. HSU 83571

Renewal Date: June 30, 2015

UNION COUNTY

SURVEYO

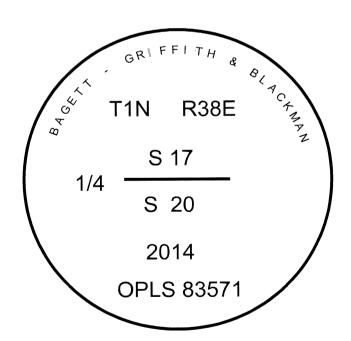

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 16° East declination, the distances are to a 60d spike in the right hand side of the bearing trees. Bearings are to a washer marked OPLS 83571 set in the upper portion of the BT blaze.

N-07