


Land Surveying & Boundary Consulting

P.O. Box 19 Mill City, OR 97360 (503) 897-2722

# CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Page 2 of 2

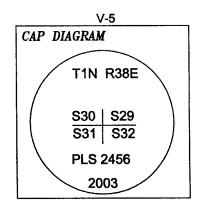

### Description of monument and accessories I established to perpetuate the original location of this corner:

Monument Set:

Replaced existing monument with a 3 1/4 in. aluminum cap marked as shown on 5/8" x 36 in. rebar buried 24 ins. in the ground. The bottom 18 ins. is in a concrete filled drill hole with a magnet at its base, with rock mound.

Accessories Set:

A ponderosa pine, 35 ins. diam. bears S 33 1/2° W 128.5 ft. marked T1N R38E S31 BT on a double baze with a brass washer marked PLS 2456.

Removed Perry's northeast BT that was sickly and leaning for better satellite visibility. Red paint, posts and signs added as needed.

NAD 83 (CORS 2002) Coordinates:

Geographic

State Plane (North Zone)

45°31'46.8062" N

N 209,811.884 Meters

118°05'50.3749" W

E 2,687,645.940 Meters

Convergence 1° 42'14"

Equipment: Staff compass, Var. 18° E, nylon tape,

clinometer

Date: July 23, 2003

Crew: Ron Walter, Michael Cordoza

See also the Record of Survey filed concurrently with this certification.

Kall 11/25/03

REGISTERED PROFESSIONAL LAND SURVEYOR

> OREGON July 25, 1990 Evelyn R. Kalb 2456

EXPIRES: 06/30/2005

UNION COUNTY SURVEYOR

Date Received 12/8/03

Date Filed 12/31/03

Filed By R. ROSINSON DOUTY

File Number <u>051 - 2003</u>R



# CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Land Surveying & Boundary Consulting

P.O. Box 19 Mill City, OR 97360 (503) 897-2722 Page 1 of 2

#### History of original corner establishment:

John W. Kimbrell, 1891, Contract 579

Set post 4 ft. long 4 ins. square 12 ins. in the ground. Note-could not set deeper on account of rock. Raised mound of stone 1 ½ ft. high and 3 ft. wide at base around post.

A fir 24 ins. in dia. bears N 40° E 55 lks. (36.3 ft.) dist. marked T1N R38E S29 BT

A fir 10 ins. in dia. bears S 8° E 177 lks. (116.8 ft.) dist. marked T1N R38E S32 BT

A fir 12 ins. in dia. bears S 38° W 146 lks. (96.4 ft.) dist. marked T1N R38E S31 BT

A fir 8 ins. in dia. bears N 39° W 112 lks. (73.9 ft.) dist. marked T1N R38E S30 BT

U.S. Forest Service Corner Card, J. Banks, BLM Forester, 1973

Found: Mound of stone

30 in. P. pine N 40° E 55 lks. (36.3 ft.) dist. legible marks "S29 T1N R38E BT"

Set: New fir post and another mound of stone at corner from the only BT present. Original notes call for a fir instead of pine, in this location.

Howard L. Perry, PLS 1294, 1980, C.S. 38-80

Found stone mound & original BTs:

24 in. now 28 in. P. pine, with scribing "T1N R38E S29 BT" visible, bears N 40° E 36.3 ft. (N 40° E 55 lks.)

A down & rotting 12" D. fir with scribing "1N R38E S32" visible, bears S 8° E 116.8 ft. (S 8° E 177 lks)

Found scribed wood approx. 50 ft. downhill from SW BT

Found stumphole at NW BT

Set 5/8" x 30" rebar with yellow cap marked AP & A and scribed New BTs

8 in. P. pine scribed "T1N R38E S29 1099 BT" bears N 42° E 8.9 ft.

14 in. D. fir scribed "T1N R38E S32 1099 BT" bears S 83° E 24.6 ft.

12 in. D. fir scribed "T1N R38E S30 1099 BT" bears N 33° W 21.1 ft.

Duane I. Griffith, PLS 644, 1980, C.S. 73-80

Found monument of record.

Gary L. Langlitz, PLS 1099, 1983, C.S. 43-83

Found 5/8" iron pin.

#### Description of corner evidence found:

Monument Found:

A bent 5/8" diam. rebar with yellow plastic cap, up 2', in partial stone collar.

Accessories Found:

A ponderosa pine, 27 ins. diam., bears N 40° E 36.3 ft., alive & healthy with scribing visible on a partially healed single blaze. (Orig. BT)

Did not look for or find other original BTs

A sickly leaning ponderosa pine 10 ins. diam. bears N 42° E 8.9 ft., with scribing visible on a partially healed double blaze. (Perry BT)

A Douglas fir, 17 ins. diam., bears S 83° E 24.6 ft., alive & healthy with scribing visible on a partially healed double blaze. (Perry BT)

A Douglas fir, 16 ins. diam., bears N 33° W 21.1 ft., alive & healthy with healed blaze. (Perry BT)

(Continued on Page 2)

