UNION COUNTY SURVEYOR

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT: None

No record of further monumentation found in Union County survey records.

T1N R39EL-03

S 18

DESCRIPTION OF CORNER EVIDENCE FOUND:

NONE

See Survey Number 025-1998

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

The surveyed position of the corner fell on the bank of Highway 204, therefore I set a 2 ½ x 30 aluminum pipe with cap as shown, 28 inches in the ground for a Witness Corner, bearing N

O°11/51" Woof the corner position a distance of 120

0°11'51" W of the corner position a distance of 120.00 ft. near the northerly edge of the old roadway, from which:

NEW BEARING OBJECTS AND TREES:

A 7 inch Dia. Ponderosa Pine bears N 56° E, a distance of 5.33 feet, marked Y WC BT

A 19 inch Dia. Douglas Fir bears S 14° W, a distance of 67.16 feet, marked Z WC BT

A 5/8" x 30" iron rod bears S 55° W, a distance of 12.51 feet, marked SW RP

A 7 inch Dia. Ponderosa Pine bears N 35° W, a distance of 9.75 feet, marked X WC BT


I hereby certify that the corner was monumented on July 29, 1998. Witness: Jeff Madsen, Greg Engelgau, and Norb Volny.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON

RICK G. ROBINSON 2219

Renewal Date December 31, 1998

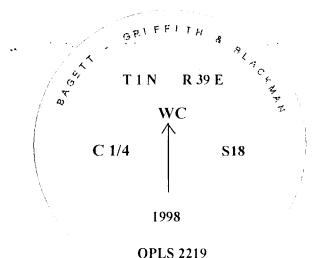

UNION COUNTY
SURVEYOR

I used the es

Date Received

8/10/98

Date Filed

8/29/98

Filed By Hyay T. Black

File Number <u>019 - 1998</u> R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination, the distances are to the center of the bearing object. Distances are to a 60d spike driven into the root crown of the bearing tree in the right side. A brass washer marked OPLS 2219 was attached to the BT blaze.