

UNION COUNTY SURVEYOR

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

NONE

No record of subsequent monumentation found in Union County survey records.

DESCRIPTION OF CORNER EVIDENCE FOUND:

NONE

See Survey #029-2004

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 5/8" x 30" iron pin with 1 1/2" aluminum cap marked as shown below, 26" in the ground from which:

New Bearing Tree and Object:

A 5/8" iron pin with yellow plastic cap marked "BGB SURVEY MARKER" bears North, a distance of 29.64 feet. Pin is set adjacent to a large wooden fence post with rock crib.


An 8" Ponderosa Pine bears South 59° West, a distance of 56.15 feet, marked SE 1/16 S14 BT.

I hereby certify that the corner was monumented on September 27, 2004.

Witness: Gregory T. Blackman Jr.

Corner falls on the Northeast side of an existing fence corner post, with fences running East, West and South.

T 1 N R 40 E M-20

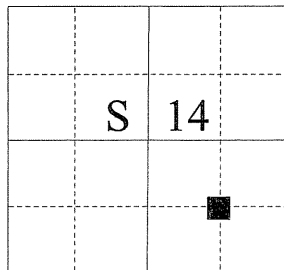


REGISTERED
PROFESSIONAL
LAND SURVEYOR

Rick G. Robinson

OREGON
July 17, 1986
RICK G. ROBINSON
2219

Renewal Date December 31, 2004

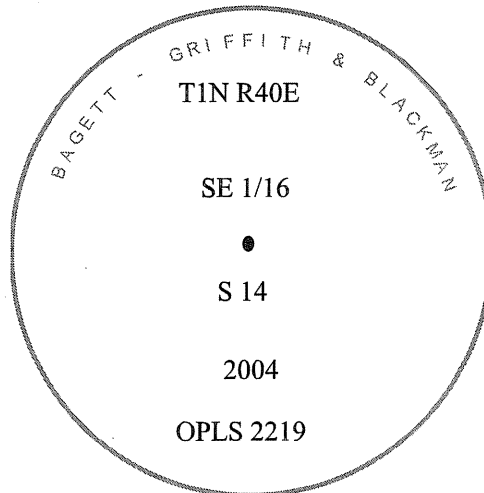

UNION COUNTY SURVEYOR

Date Received 10/4/04

Date Filed *Greg T. Blackman*

Filed By 10/4/04

File Number 041-2004R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination, the distance to the pin is to the center of the cap, and the distance to the bearing tree is to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 2219 to the bearing tree blaze.