


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Land Surveying & Boundary Consulting

P.O. Box 19 Mill City, OR 97360 (503) 897-2722

Note: This quarter corner controls the subdivision of Section 5 as shown on the original plat for Section 5. This is not a perpetuation of the quarter corner set by Thompson in 1863. Campbell's survey and resulting plat superceded Thompson's quarter corner. This corner was not set during Campbell's survey.

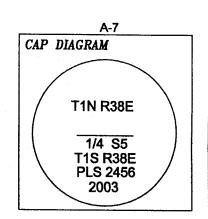

History of original corner establishment:

Corner not previously set.

Description of corner evidence found:

Corner not previously set.

Description of monument and accessories I established to perpetuate the original location of this corner:

Monuments Set:

A 3 1/4" aluminum cap, marked as shown, on a 2 1/2" x 30" aluminum pipe (standard U.S.F.S. aluminum monument).

Accessories Set:

A ponderosa pine, 13 ins. diam., bears S 73 3/4° E 50.5 ft. marked 1/4 S5 BT on a double blaze with a brass washer marked PLS 2456.

A Douglas fir, 11 ins. diam., bears S 3° W 56.1 ft. marked 1/4 S5 BT on a double blaze with a brass washer marked PLS 2456.

The South quarter corner for Section 32 bears N 89°40'41" W 242.97 ft. Red paint, posts and signs added as needed.

NAD 83 (CORS 2002):

Geographic 45°30'52.8657" N 118°05'14.2188" W

State Plane (North Zone) N 208,170.848 Meters E 2,688,479.716 Meters

Convergence 1° 42'40"

Equipment: Nikon Total Station

Date: Sept. 16, 2003

Crew: Ron Walter, Collin Edwards-Hill, Michael

Cordoza

See also the Record of Survey filed concurrently with this certification.

REGISTERED PROFESSIONAL LAND SURVEYOR

> OREGON July 25, 1990 Evelyn R. Kalb 2456

EXPIRES: 06/30/2005

UNION COUNTY SURVEYOR

Date Received 2/3/04

Date Filed 2/25/04

Filed By R. RUSINSON DEWTY

File Number <u>003-7004</u>R