## UNION COUNTY SURVEYOR


# **CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

#### HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by David P. Thompson under GLO contract Number 103, dated September 3, Surveyor General record states: Set post for 1/4 sec cor in mound of earth with

charred stake, pits, trench as per instructions

Survey No. 37-74 states "stone found at E 1/4corner"

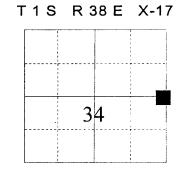

No record of subsequent monumentation found in Union County survey records.

## DESCRIPTION OF CORNER EVIDENCE FOUND:

Found stone 14x12x6 with faint marks visible. Stone loose on west side of irrigation ditch.

## DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

I reestablished the corner position at the record position of survey no. 37-As described above, the position falls on the bank of an irrigation ditch. I therefore set a  $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown below, 36" in the ground for a reference monument.

New Bearing Objects: (Bearing and distance are to the TRUE corner position) A  $5/8 \times 30$  inch iron rebar with aluminum cap bears N38°E, a distance of 17.65 feet, marked NE RP.

A 5/8 x 30 inch iron rebar with aluminum cap bears S41°E, a distance of 18.54 feet, marked SE RP.

A 2½ inch aluminum cap bears S76°W, a distance of 12.95 feet, marked as shown below.


A 5/8 x 30 inch iron rebar with aluminum cap bears N35°W, a distance of 17.53 feet, marked NW RP.


I hereby certify that the corner was monumented on October 28, 1998. Witness: Norbert Volny, Greg Blackman Jr.

> REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON July 17, 1986

RICK G. ROBINSON 2219 Renewal Date December 31, 1998

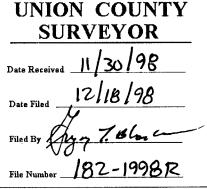

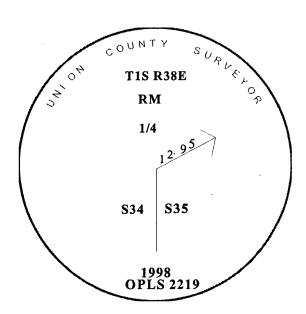

I used the Leica TCA 1100 total station in the establishment of the new accessories. The basis of bearing is the same as survey no. 047-1998.