
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by David P. Thompson under GLO contract 103, dated September 3, 1863. Surveyor General field notes state: Set post for 1/4 sec. corner in mound of earth with charred stake pits trench as per instructions.

T1SR39EC-09

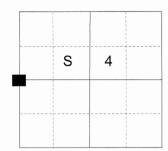

In 1889 Union County Surveyor J. W. Kimbrell perpetuated the monument as part of Old Book Survey # 196 filed October 19, 1889. Union County Survey records state: Set stone 6 x 9 x 22 for 1/4 sec. cor. bet. sec. 4 & 5.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 6" x 9" x 22" stone marked. 1/4' lying horizontally along South East side of fence corner from which fences bears North, South, and East.

SEE SURVEY NUMBER 011-2018

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position of found stone, I set a 2 $\frac{1}{2}$ " x 30" aluminum pipe with a 3" aluminum cap marked as shown, 25" in the ground,. From which:

NEW BEARING OBJECTS:

A 5/8" x 30" iron pin with 1 ½" aluminum cap bears North 3°08' East, a distance of 12.80 feet, marked N RP. A 5/8" x 30" iron pin with 1 ½" aluminum cap bears North 88°50' East, a distance of 22.34 feet, marked E RP. A 5/8" x 30" iron pin with 1 ½" aluminum cap bears South 1°29' West, a distance of 19.56 feet, marked S RP.


Monument falls approximately 1' South East of corner to North, South, and East bearing fences. Bury the stone underneath the monument. Land to the West is tilled agricultural ground and unsuitable for reference monument.


I hereby certify that the corner was perpetuated on April 6, 2018.

Witness: Kyle A. Tucker



Renewal Date: June 30, 2019

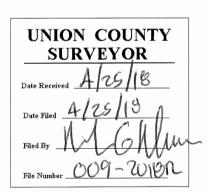

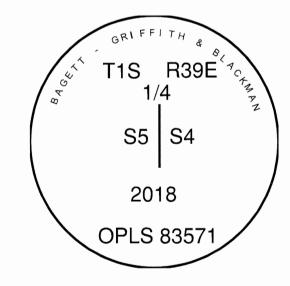

I used an RTK GPS in the establishment of the new accessories. Basis of Bearing is as per Survey 011-2018. Distances are to the center of the aluminum caps.