


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Corner originally established by David P. Thompson under GLO Contract Number 103, dated July 3rd, 1863. Surveyor General Field Notes state:

T 1 S R 39 E N-17

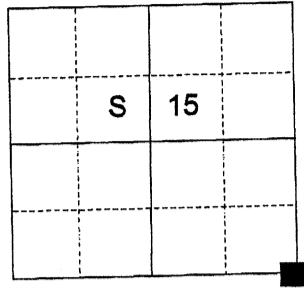

Set post for corner to sec 14,15,22 an 23

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

A 4' diam. embedded mound of stone with a wood remnant on the East side of the mound. Area is otherwise devoid of wood. Ancient rock jacks bear North/South with wire remnants


SEE SURVEY NUMBER 019-2023

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:**

At mound of stone position, I set a 2 1/2" aluminum pipe, 15" in the ground, with 3" aluminum cap marked as shown and in a 4 ft diameter mound of stone, from which:

**NEW BEARING OBJECTS:**

- A 5/8" x 15" iron pin bears North 56°13' East a dist. of 23.28 feet, with 1 1/2" aluminum cap marked NE RP
- A 5/8" x 15" iron pin bears South 33°48' East a dist. of 23.35 feet, with 1 1/2" aluminum cap marked SE RP
- A 5/8" x 15" iron pin bears South 50°52' West a dist. of 31.28 feet, with 1 1/2" aluminum cap marked SW RP
- A 5/8" x 15" iron pin bears North 51°02' West a dist. of 25.11 feet, with 1 1/2" aluminum cap marked NW RP

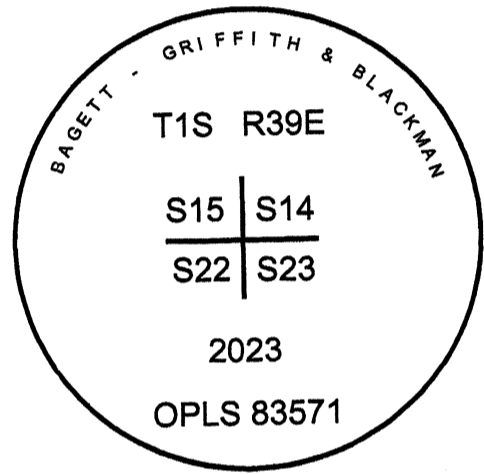

I hereby certify that the corner was monumented on August 4<sup>th</sup> 2023.  
Witness: Kyle Tucker, Adam Gordon

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*[Signature]*

OREGON  
June 2, 2010  
JEFFREY S. HSU  
83571

Renewal Date: June 30, 2025

I used a Leica GS18 with RTK in the establishment of the new accessories. Bearing and distance is measured to the centers of the aluminum caps

**UNION COUNTY  
SURVEYOR**

Date Received 9/5/23

Date Filed 9/5/23

Filed By *[Signature]*

File Number 023-2023R