


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by David P. Thompson under GLO Contract Number 103, dated July 3rd, 1863. Surveyor General Field Notes state:

Set post for 1/4 sec corner from which
A Pine 10 in. diam bears S78°W 52 lks dist
A Pine 8 in. diam bears N65°W 58 lks dist

T 1 S R 39 E N-19

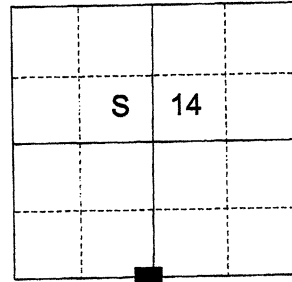

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found recent rock jack fence corner from which fences bear West and South. Lessee of the land states he rebuilt the rock jack in the same spot as the original. To the West and South fencing remnants are +/-70 years of growth in the Ponderosa Pines. Accepted as best available evidence of original corner position.


SEE SURVEY NUMBER 019-2023

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At fence corner position, I set a 2 1/2" x 30" aluminum pipe, 10" in the ground, with 3" aluminum cap marked as shown, with mound of stone 4 ft. in diam. from which:

NEW BEARING OBJECTS:

A 5" White Fir bears North 42° East, a dist. of 21.00 feet, marked X BT
A 13" Ponderosa Pine bears South 71° East, a dist. of 32.45 feet, marked 1/4 S23 BT
A 19" Ponderosa Pine bears South 34° West, a dist. of 20.45 feet, marked 1/4 S23 BT
A 13" Ponderosa Pine bears North 26° West, a dist. of 24.85 feet, marked 1/4 S14 BT

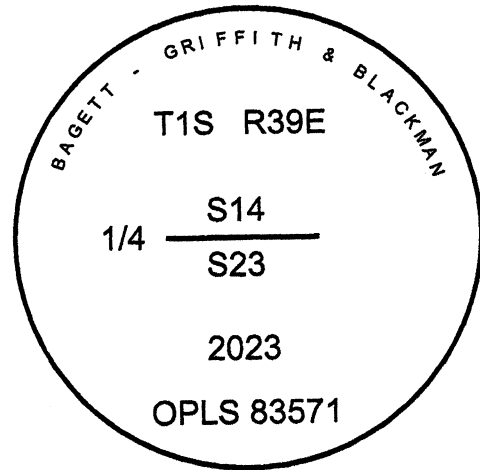

I hereby certify that the corner was monumented on August 4th, 2023.
Witness: Kyle Tucker, Adam Gordon



Renewal Date: June 30, 2025

I used a tape and compass in the establishment of new the accessories. Bearing is measured to a brass washer labeled OPLS 83571 located at the center of BT blaze, with a declination of 14° East. Distance is measured to a 60d spike nailed to the right side base of tree.

