


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by David P. Thompson under GLO Contract Number 103, dated July 3rd, 1863. Surveyor General Field Notes state:

Set post for 1/4 sec corner in mound of stone

T 1 S R 39 E P-17

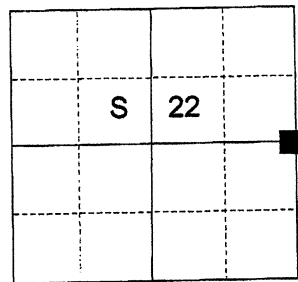

DESCRIPTION OF CORNER EVIDENCE FOUND:

A fence corner rock jack from which fences bears North, South and West. Position is harmonious with section corners to North and South


SEE SURVEY NUMBER 019-2023

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At the fence corner, I set a 5/8" x 15" iron pin, 14 inches in the ground, with 2 1/2" aluminum cap marked as shown with collar of stone 1 ft. in diam., from which:

NEW BEARING OBJECTS:

- A 4'x2'x1' stone bears North 58°55' East, a dist. of 21.74 feet, marked X BO
- A 7" Ponderosa Pine bears South 21° East, a dist. of 53.20 feet, marked 1/4 S23 BT
- A 2'x3'x4' stone bears South 31°55' West, a dist. of 30.49 feet, marked X BO
- A 5/8" x 15" iron pin bears North 43°50' West a dist. of 41.63 feet, with aluminum cap marked NW RP

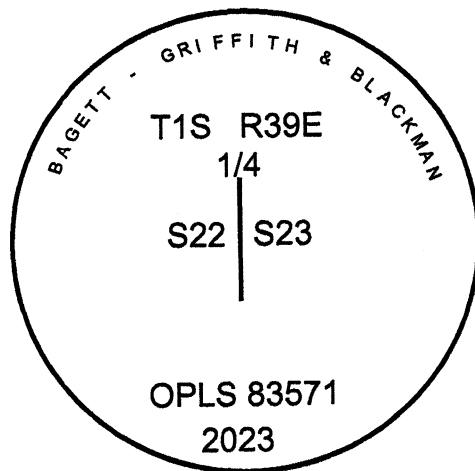

I hereby certify that the corner was monumented on August 4th, 2023.

Witness: Kyle Tucker, Adam Gordon



Renewal Date: June 30, 2025

I used a Leica GS18 with RTK in the establishment Of the new accessories. Bearing of the tree is measured to a brass washer labeled OPLS 83571 located at the center of the BT blaze. Distance is measured to a 60d spike nailed to the right side base of the tree. Distance and bearing of the aluminum cap is measured to the center. Distance and bearing of the stones is measured to the center of the chiseled X.

