

UNION COUNTY SURVEYOR

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Henry Meldrum under GLO contract Number 450, dated December 1, 1882. Surveyor General record states:

Set post from which:

- A Tamarack 6" dia. bears N69°W, 51 lks.
- A Tamarack 15" dia. bears N44°E, 11 lks.

No record of subsequent monumentation found in Union County survey records.

DESCRIPTION OF CORNER EVIDENCE FOUND:
NONE

See Union County Survey 033-1998


DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position determined by survey, I set a 2½" x 30" aluminum pipe with aluminum cap marked as shown below, 26" in the ground from which:

- A 20" Douglas Fir bears S78°E, a distance of 10.17 feet, marked 1/4 S4 BT.
- A 10" Tamarack bears S16°E, a distance of 38.43 feet, marked 1/4 S4 BT.
- A 14" Douglas Fir bears S31°W, a distance of 22.85 feet, marked 1/4 S5 BT.
- A 8" Douglas Fir bears N42°W, a distance of 91.13 feet, marked X BT.

I hereby certify that the corner was monumented on August 24, 1998.
Witness: Norbert Volny, Greg Engalgau


T 1 S R 40 E C-09

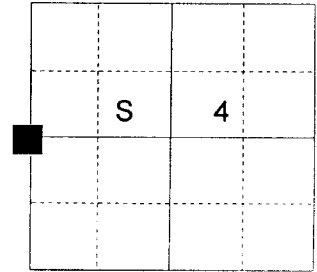

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
July 17, 1986
RICK G. ROBINSON
2219

Renewal Date December 31, 1998

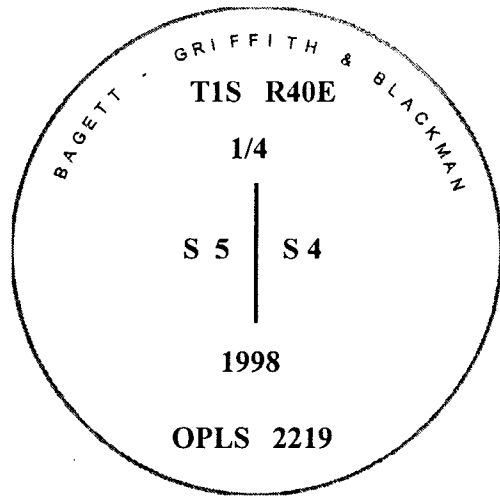

UNION COUNTY SURVEYOR

Date Received 9/2/98

Date Filed 9/26/98

Filed By Lynn T. Clark

File Number 070-1998R

I used a total station instrument in the establishment of the new accessories. The basis of bearing is the same as that of survey no. 033-1998. The distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 2219 is attached to the BT blaze.