CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Henry Meldrum in GLO Contract Number 450, dated June 11, 1882. Surveyor General Field Notes state:

Set a post 3 ft. long, 3 inches square, 24 in. in ground for 1/4 sec cor. marked 1/4 S. on N. face, from which: A pine 10 ins. in dia, bears N10°E 6 lks. dist marked 1/4 S.BT.

A pine 12 ins. in dia, bears $S35^{\circ}W$ 5 lks. dist marked 1/4 S BT.

T 1 S R 40 E R-15 S 27

DESCRIPTION OF CORNER EVIDENCE FOUND:

None

See Survey Number 041-2015

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the proportionate position, I set a $2 \frac{1}{2}$ " x 30" aluminum pipe 25" in the ground, with a $2 \frac{1}{2}$ " aluminum cap marked as shown below. From which:

NEW BEARING OBJECTS:

An 8" Lodgepole Pine bears North 59° East, a distance of 13.85 feet, marked 1/4 S22 BT. An 8" Lodgepole Pine bears South 49° East, a distance of 3.22 feet, marked 1/4 S27 BT. An 8" Lodgepole Pine bears South 29° West, a distance of 30.60 feet, marked 1/4 S27 BT. A 9" Lodgepole Pine bears North 27° West, a distance of 22.35 feet, marked 1/4 S22 BT.

I set a steel fencepost approximately 1 foot North of corner monument.


I hereby certify that the corner was monumented on June 24, 2015.


Witness: Thomas J. Kopp

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
Julie 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2017

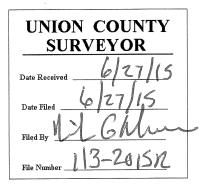

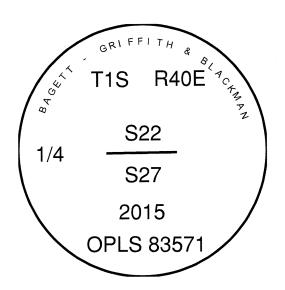

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 16° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.