


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Line Tree between corners G-05 & H-05

History of original corner establishment:

Original line tree established in 1898 by Alonzo Gesner under contract #683. At 25.74 chains, a 30" Fir, a line tree marked with 2 notches on the N.&S. sides.

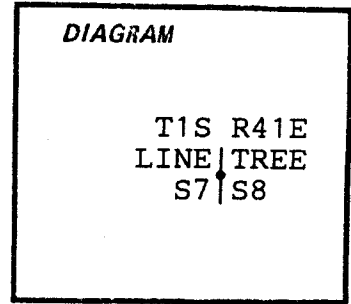

Description of corner evidence found:

I found a dead & down, badly decayed white fir of undetermined diameter. I lifted the bark from the bottom and found two chop marks 4-5 feet above the base of the tree.

Description of monument and accessories I established to perpetuate the original location of this corner:

Cap is stamped:

In the root crown, I set a 2 1/2"x30" aluminum capped aluminum pipe rising 6", no stones available. Set steel fence post 3 ft. North of corner.

T1S R41E
S7 | S8
LINE TREE MONUMENT
RLS1848
1986

New BT's:

- An 8 1/2" Doug Fir bears N67 1/2°E, 34.3 ft., blazed&scribed: APS8BT
- A 10 1/2" Western Larch bears N35 1/2°W, 14.5 ft., blazed&scribed: APS7BT

Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982. A 3/4" brass disk stamped "RLS 1848" was nailed to the lower end of the blazes.

Corner is 180 ft. east of Rd. 6200 and 5/8 mile South of 6200525 on westerly slope.

Compass Declination: 19 1/2°E
Witness: Jeremy Sutton

I hereby certify that the above described corner monument and/or accessories were established as hereon described on Nov. 10, 1986



UNION COUNTY SURVEYOR
Received 12-18-86
Filed 12-24-86
By G. LANGLITZ, DEPUTY
File No. 322-86 R

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)