


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

U-13

History of original corner establishment:

Corner not previously established.

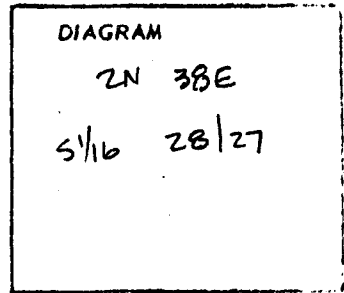

Description of corner evidence found:

N/A

REGISTERED
PROFESSIONAL
LAND SURVEYOR

James H. Buisman

OREGON
JULY 22, 1977
JAMES H. BUISMAN
1097

Description of monument and accessories I established to perpetuate the original location of this corner

At the position described above, I set a 2½" aluminum cap on a 2½" x 30" aluminum pipe 25" in the ground marked as shown.

From which I scribed BTs:

- A fir 7" in diam. bears N 82°16' W 16.9' scribed S 1/16 S 28 BT.
- A fir 8" in diam. bears N 53°49' E 7.5' scribed S 1/16 S 28 BT.

I nailed a brass washer marked OPLS 1097 to BT blazes.

I set a steel fence post 5' South with signs 54-2 and 54-4.


I set a fiberglass fence post 5' West with signs 54-2.

I painted a red band around BTs and face of scribe.

I used a steel tape and Wild T-2 and measured a horizontal distance to the center of the BTs.

This corner was set October 28, 1980. Witness by Patrick L. Murphy.

See map of survey.

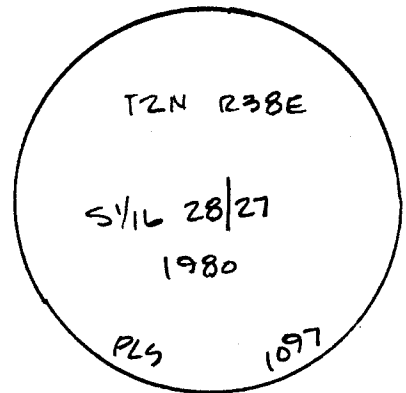

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the day of.....
 by
 (COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY
SURVEYOR

Date Received _____
 Date Filed _____
 By _____
 File No. 236-83R